<u>ww.</u>collegehillshonda.com Publications No.

INSTALLATION INSTRUCTIONS

FRONT GRILLE P/N 08F21-T7S-100 Application

2018 HR-V

VERSION 1

Issue Date **JUL 2017**

PARTS LIST

Front grille



License frame



TOOL AND SUPPLIES REQUIRED

Phillips screwdriver

Ratchet

10 mm Socket

Tape

Blanket

Shop towel


The following tools are available through the Honda Tool and Equipment Program. On the iN, click on: Service > Service Bay > Tool and Equipment Program, then enter the number under "Search." Or, call 888-424-6857.

- Trim Tool Set (T/N SOJATP2014)
- Plastic Trim Tool (T/N SILTRIMTL10)

INSTALLATION


Customer Information: The information in this installation instruction is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely add equipment to your vehicle. These procedures should not be attempted by "do-it-vourselfers."

- 1. Disconnect the negative cable from the battery.
- 2. Remove the front bumper:
 - Wrap a shop towel around the lever.
 - Attach tape to the areas shown on each side.

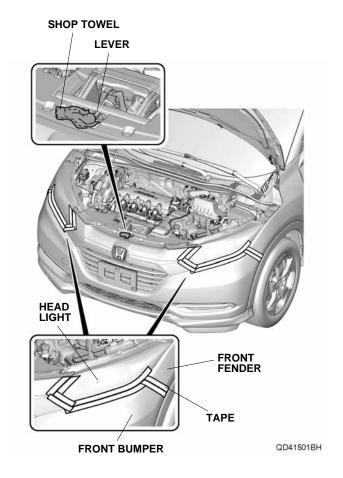


08F21-T7S-1000-90

· Remove the grille cover.

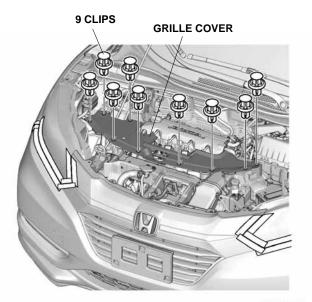


QD41502BH

Remove the 12 clips.

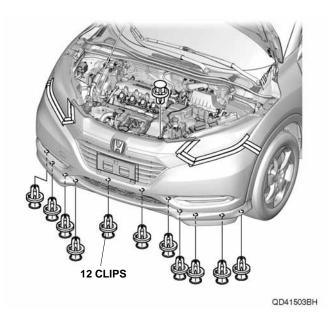

 Remove four clips and two self-tapping screws on each side.

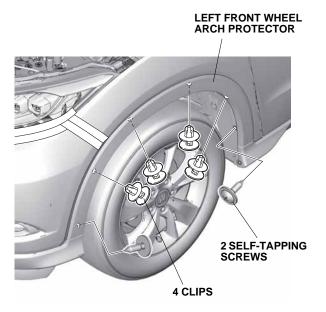

QC72104AH

Remove the front wheel arch protector on each side.




· Remove the self-tapping screw on each side.




QD41504AH

• Release four retaining tabs on each side.

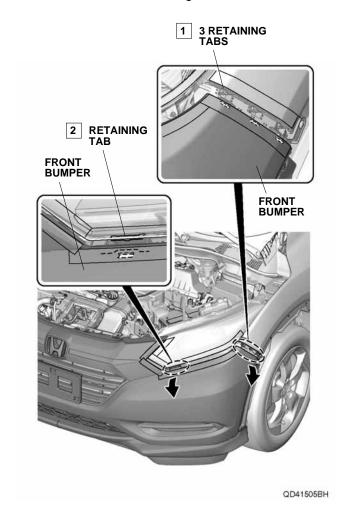


 With the help of an assistant, remove the front bumper and unplug the vehicle connectors, if equipped. Place the front bumper on the blanket to prevent damage.

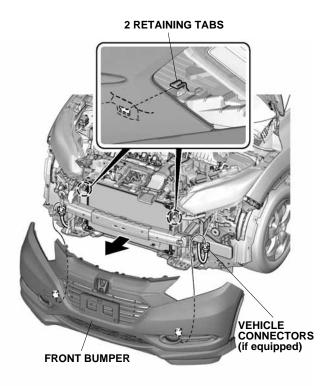


QD41506BH


3. Remove the front grille from the front bumper.

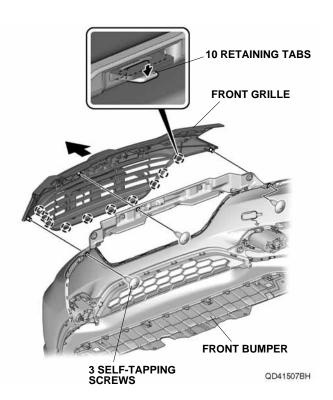

4. Remove the license plate (if installed).

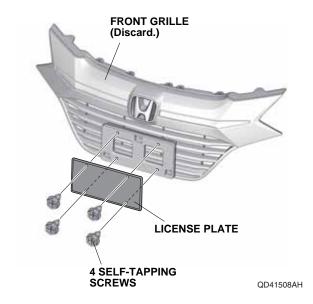


5. Install the license plate to the license frame (if required).

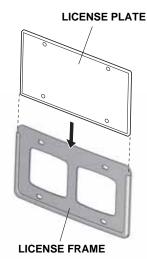


QD41509AH

Attach the license frame to the front grille (if required).

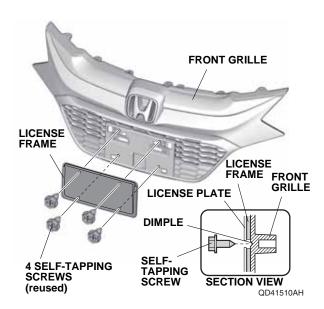

7. Install the front grille on the front bumper.

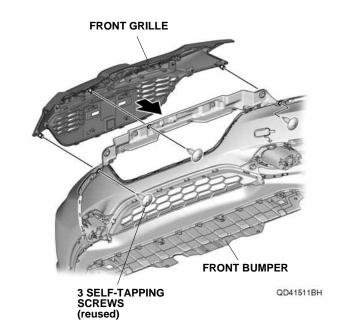

- 8. Check that all wire harnesses are routed properly and all connectors are plugged in.
- 9. Install all removed parts.
- 10. Connect the negative cable to the battery.
- 11. Press and hold the audio unit power button for 2 seconds to restore the audio and navi (if equipped) system functions.
- 12. Set the clock on vehicles without navigation.
- 13. If necessary restore the systems back to normal operation as described in the service information.