



HONDA INSTALLATION INSTRUCTIONS

Accessory
REAR UNDER SPOILERS
P/N 08F03-TGS-100

Application
2019 PASSPORT

Publications No.
VERSION 1
Issue Date
JAN 2019

PARTS LIST

Right rear under spoiler



Left rear under spoiler



12 Clips



TOOLS AND SUPPLIES REQUIRED

Phillips screwdriver

10 mm Open end wrench

5 mm Hex wrench

Masking tape

Blanket

Shop towel

Eye protection (faceshield, safety goggles, etc.)

Diagonal cutters

Pushpin

Drill


3 mm, 6 mm, 8 mm, and 12 mm Drill bits

File

The following tools are available through the Honda Tool and Equipment Program. On the iN, click on Service > Service Bay > Tool and Equipment Program, then enter the number under "Search." Or, call 888-424-6857.

- Trim Tool Set (T/N SOJATP2014)
- Plastic Trim Tool (T/N SILTRIMTL10)
- Air Saw (T/N AT192A)

Illustration of the Rear Under Spoilers on the Vehicle

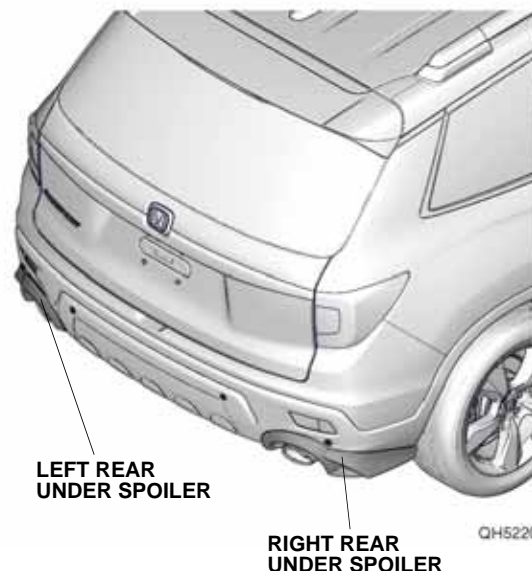


INSTALLATION

Customer Information: The information in this installation instruction is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely add equipment to your vehicle. These procedures should not be attempted by “do-it-yourselfers.”


1. Open the tailgate.
2. Disconnect the negative cable from the battery:
 - Wrap a shop towel around the hood latch.

HOOD LATCH
(Wrap with a shop towel.)

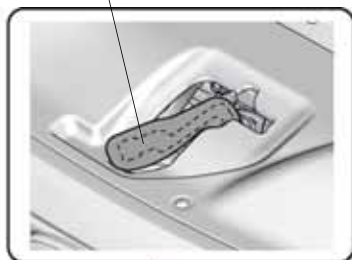


QH50702AB

- Remove the front bulkhead cover.

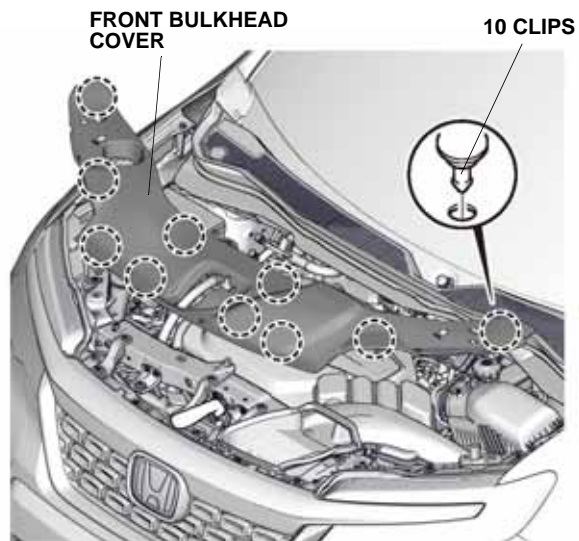


QH50703AB

- Remove the intake air tube.
- Disconnect the negative cable from the battery.

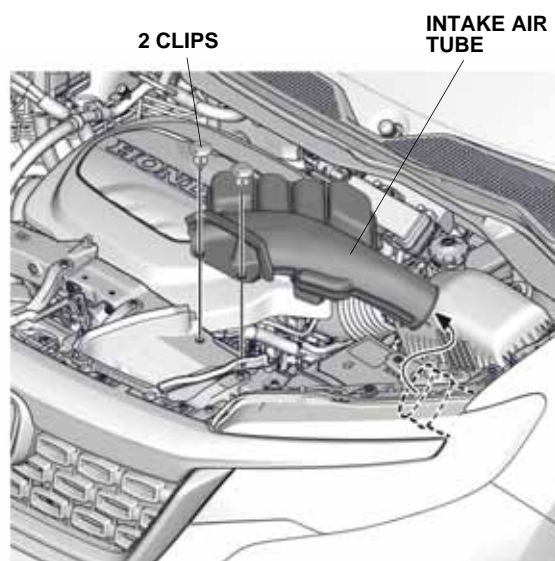


QH50704AB

3. Open the right rear door.

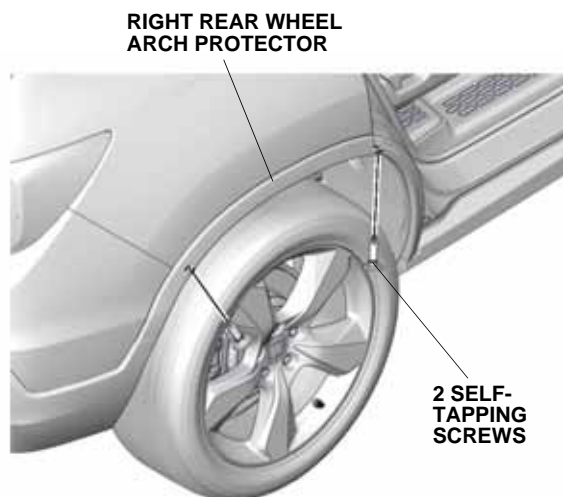

QH51502AC


4. Remove the two self-tapping screws.
5. Release the right rear wheel arch protector.

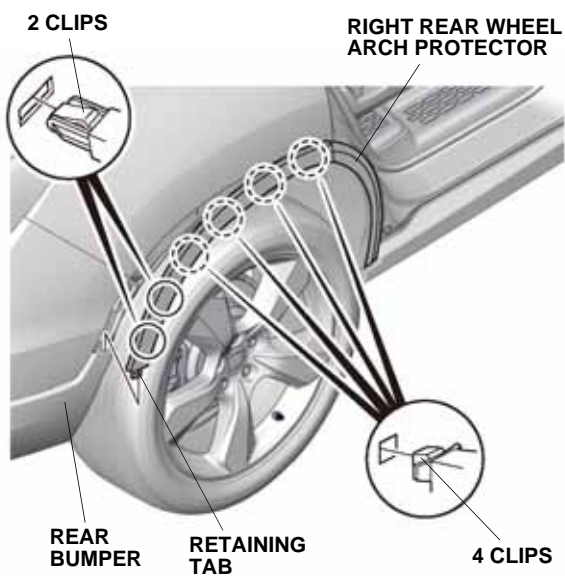

QH51503AC

6. Repeat steps 3 through 5 on the left side of the vehicle.


7. Remove the rear bumper:
- Apply masking tape as shown.

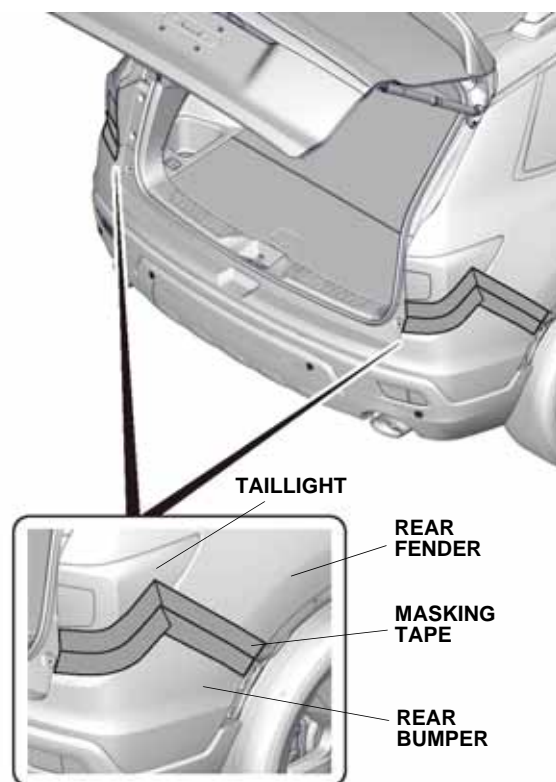


QH51504AC

- Remove the two bumper screws, 10 self-tapping screws, and three clips.

10 SELF-TAPPING
SCREWS

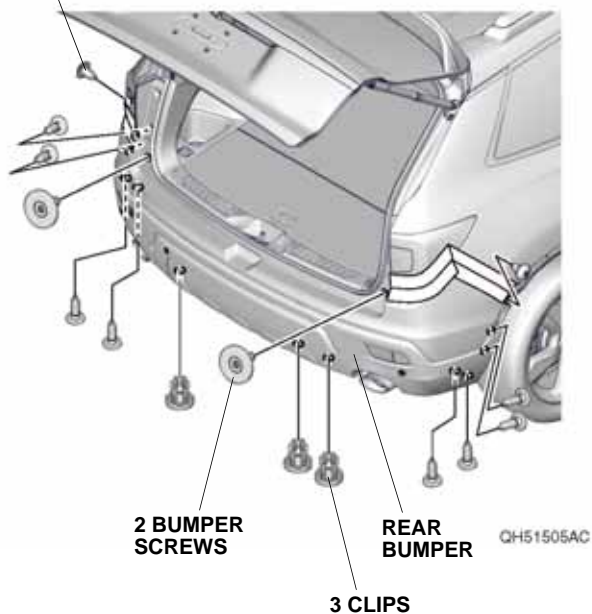


- With the help of an assistant, release the seven retaining tabs along the fenderwell on each side.

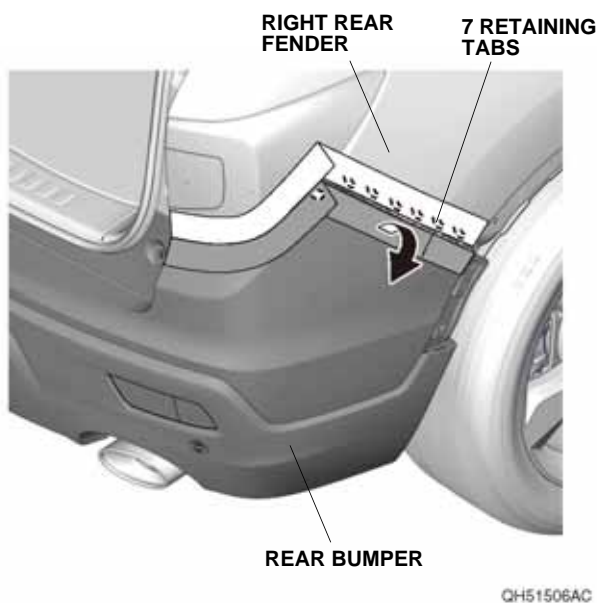


- With the help of an assistant, release the two retaining tabs on each side.




- With the help of an assistant, remove the rear bumper, and unplug the vehicle connectors.
- Place the rear bumper on a blanket.

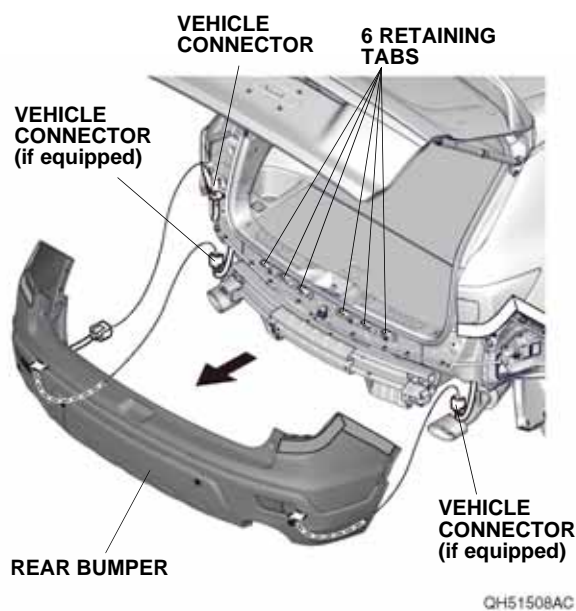


8. Remove the four clips and four self-tapping screws.

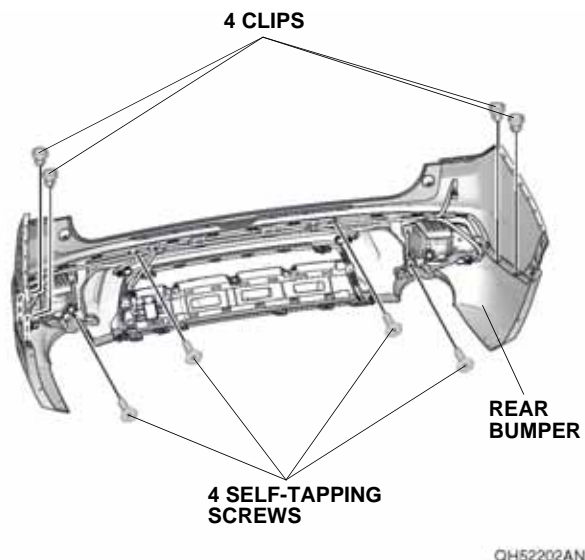

9. Remove the rear lower bumper, and unplug the vehicle connectors (if equipped).

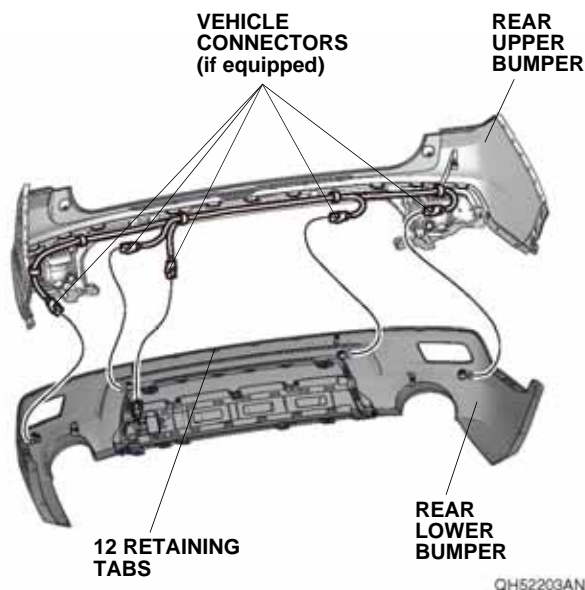


10. While wearing eye protection, use an air saw to cut the rear lower bumper at the scribe line. Remove any burrs.

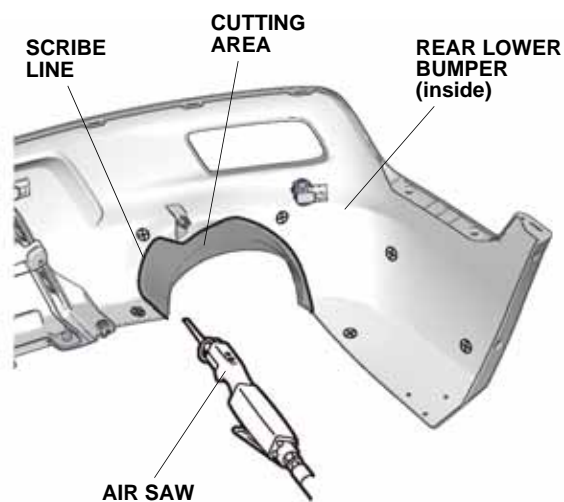


11. Mark the inside of the rear lower bumper:


- Using a pushpin, pierce the rear lower bumper at the center of the six scribe marks.
NOTE: Make sure to pierce the scribe marks perpendicular to the rear lower bumper.

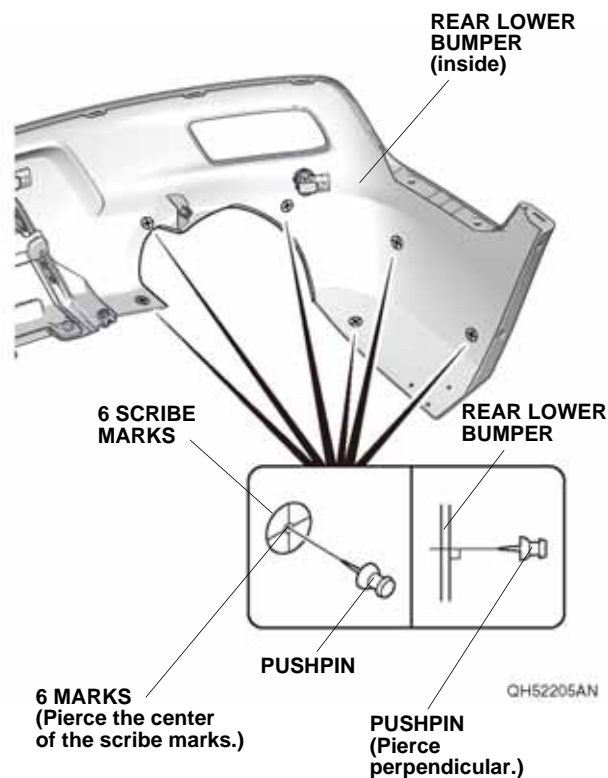


12. While wearing eye protection, drill the six pierced marks to 12 mm from the outside of the rear lower bumper:
- First, drill with a 3 mm drill bit, then follow with a 6 mm drill bit and 8 mm drill bit, and finish with a 12 mm drill bit. Remove any burrs.
- NOTE: Make sure to drill perpendicular to the rear lower bumper.

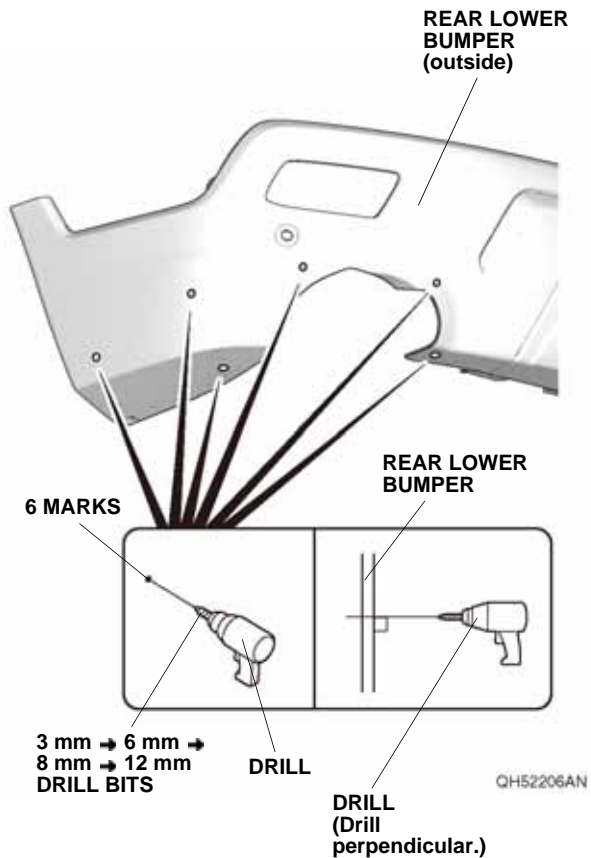

13. Install the left rear under spoiler to the rear lower bumper.

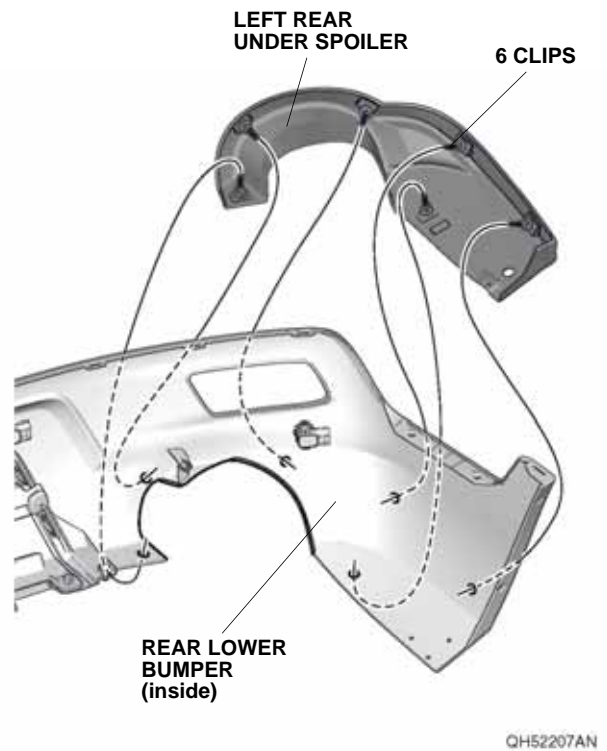

14. Secure the left rear under spoiler to the rear lower bumper with six clips.
NOTICE: Do not push the female clips too tight; you could deform the left rear under spoiler. If necessary, readjust the female clips.

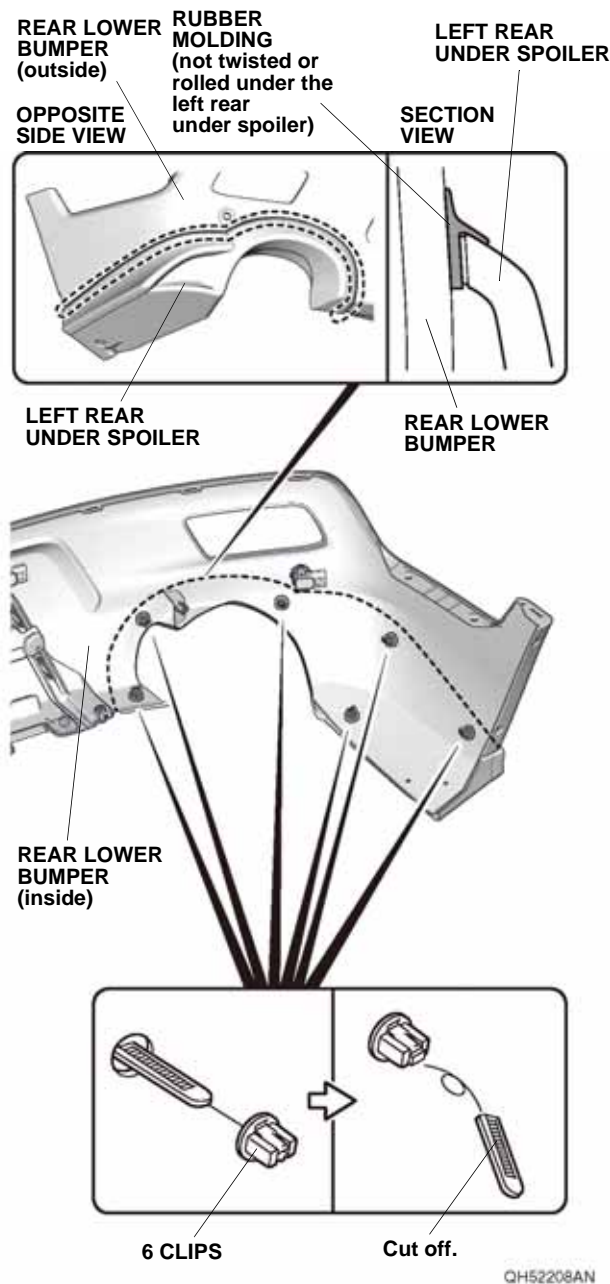

15. Repeat steps 10 through 14 on the right side of the rear lower bumper.

16. Check that all wire harnesses are routed properly and all connectors are plugged in.
17. Install all removed parts except for the front bulkhead cover and the intake air tube.
18. Connect the negative cable to the battery.
19. Install the front bulkhead cover and the intake air tube.
20. Press and hold the audio unit power button for 2 seconds to restore the audio and navi (if equipped) system functions.
21. Set the clock on vehicles without navigation.
22. If necessary, restore the systems back to normal operation as described in the service information.