



## HONDA INSTALLATION INSTRUCTIONS

### Accessory

CUP HOLDER LIGHT  
P/N 08E11-TGS-100

### Application

2021 PASSPORT

### Publications No.


VERSION 1

### Issue Date

SEP 2020

## PARTS LIST

Console panel

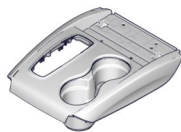

## TOOLS AND SUPPLIES REQUIRED

Phillips screwdriver

10 mm Open end wrench

Shop towel

*The following tools are available through the Honda Tool and Equipment Program. On the iN, click on Service > Service Bay > Tool and Equipment Program, then enter the number under "Search." Or, call 888-424-6857.*

- Trim Tool Set (T/N SOJATP2014)
- Plastic Trim Tool (T/N SILTRIMTL10)

### Illustration of the Cup Holder Light on the Vehicle





CONSOLE PANEL QH50701AB

## INSTALLATION

**Customer Information:** The information in this installation instruction is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely add equipment to your vehicle. These procedures should not be attempted by "do-it-yourselfers."


1. Disconnect the negative cable from the battery:
  - Wrap a shop towel around the hood latch.

### HOOD LATCH (Wrap with a shop towel.)

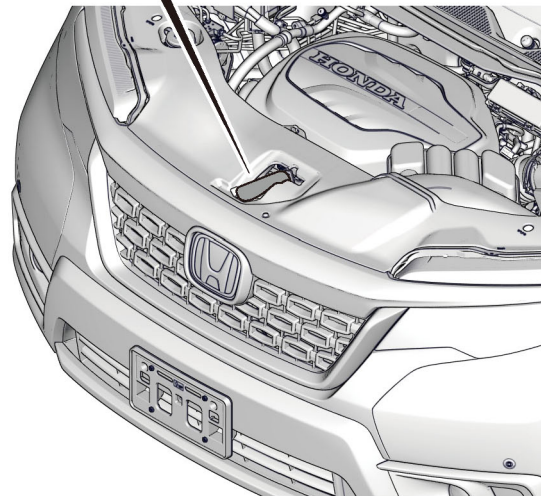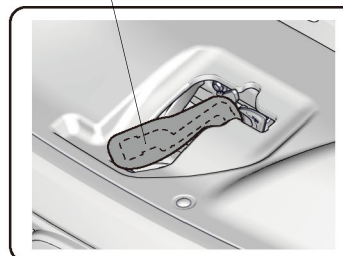


QH50702AB

- Remove the front bulkhead cover.

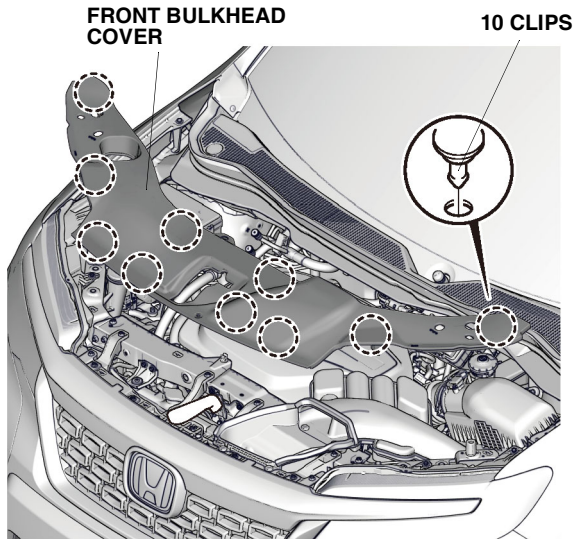


QH50703AB

- Remove the intake air tube.
- Disconnect the negative cable from the battery.

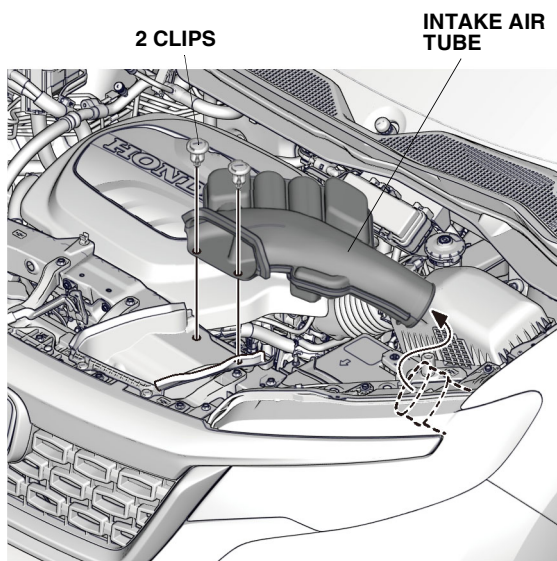


QH50704AB

2. Remove the center tray.

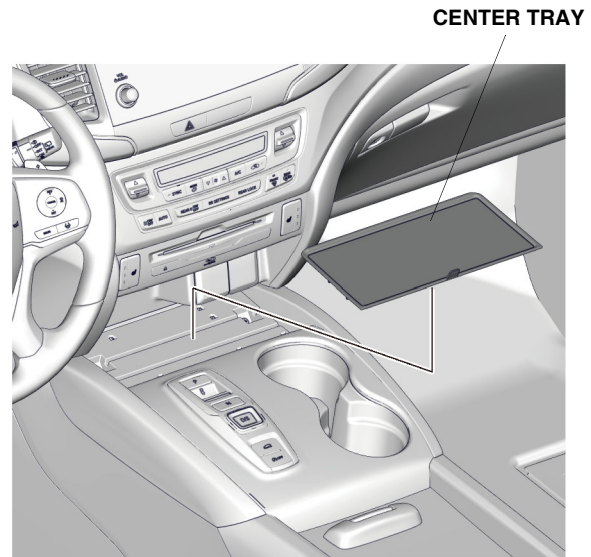


QH30602AB


3. Open the lid. Remove the console panel, and release the vehicle clip, and unplug the vehicle connectors.

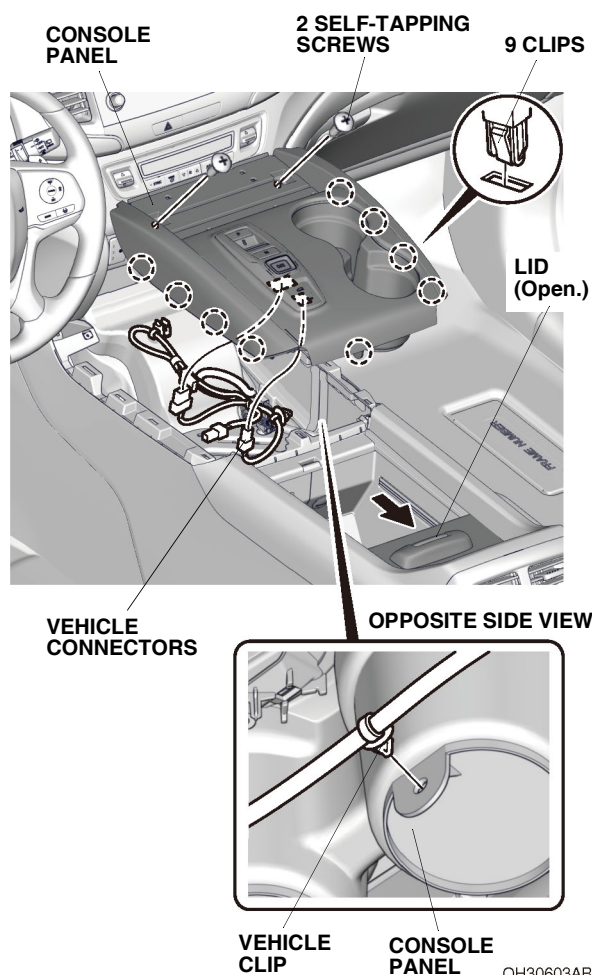

4. Remove the electronic gear selector from the console panel removed in step 3.

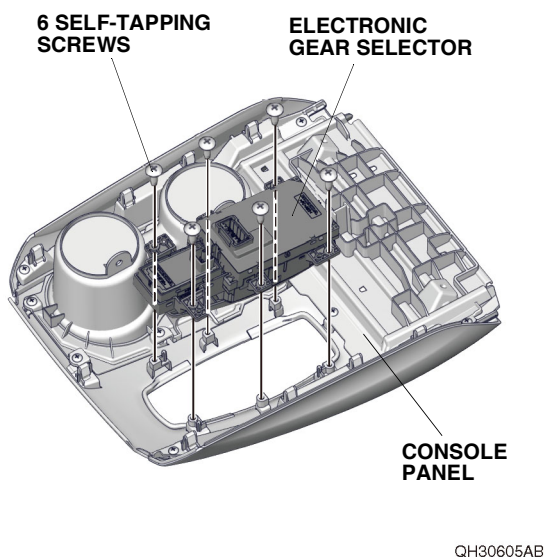


5. Install the electronic gear selector to the new console panel with six self-tapping screws removed in step 4.

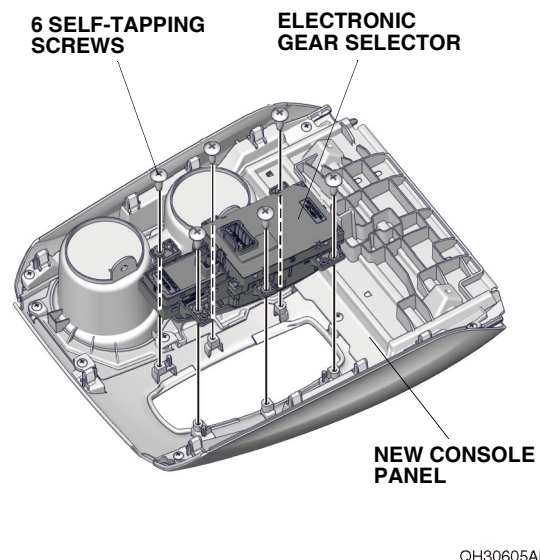

If the new console side trim panels don't match the vehicle console panel, continue with step 6; otherwise, go to step 9.


**New console side trim panels don't match the vehicle console panel**

6. Remove the left and right side trim from the removed console panel.

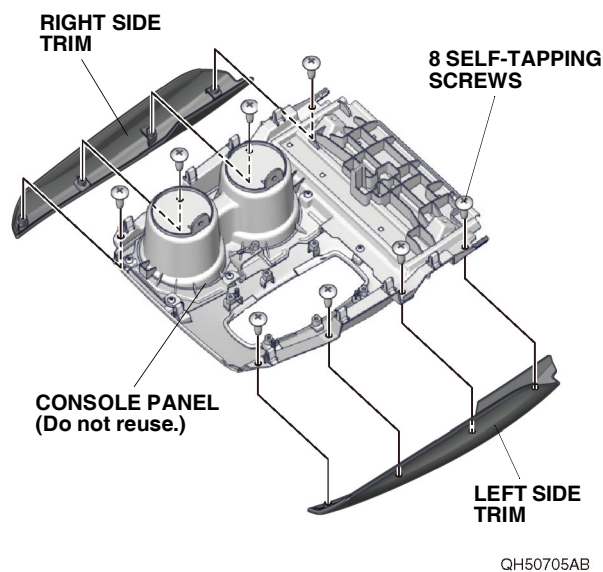





7. Remove the left and right side trim from the new console panel.

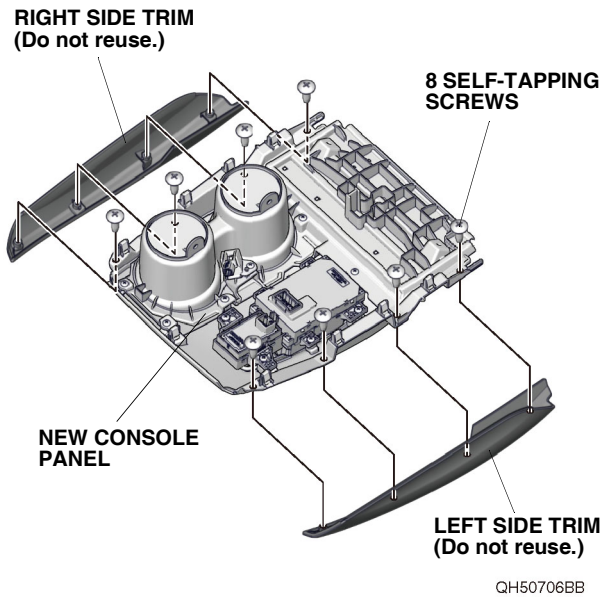

8. Install the left and right side trim to the new console panel with eight self-tapping screws removed in step 6 or 7.

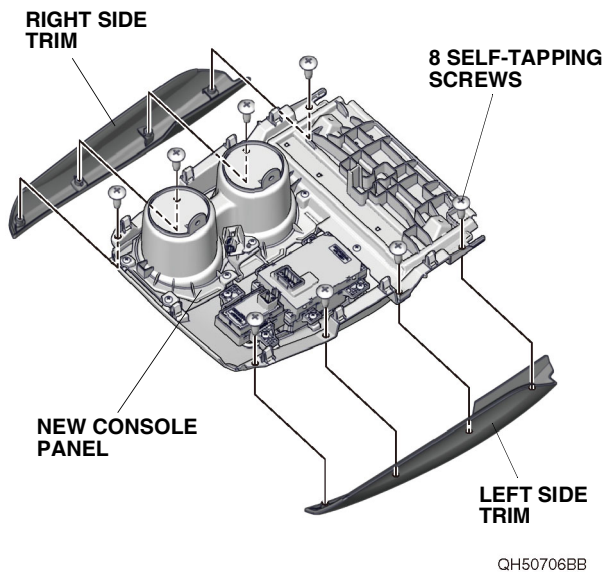

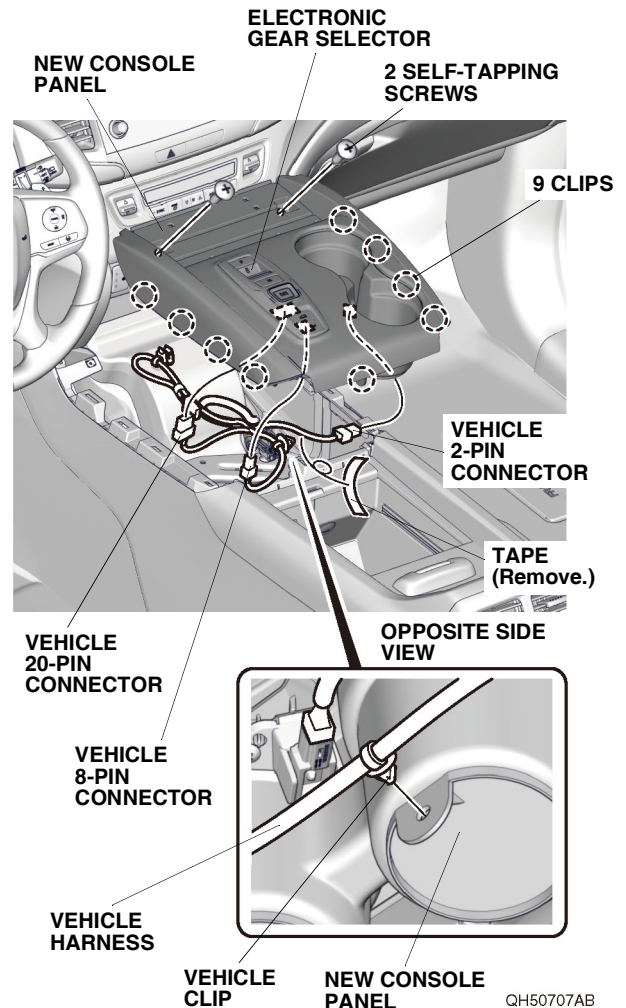

9. Remove the tape to free the vehicle 2-pin connector, and plug the vehicle 2-pin connector into the new console panel. Plug the vehicle 8-pin connector and 20-pin connector into the electronic gear selector, and secure the vehicle clip to the new console panel.





10. Install the new console panel with nine clips and two self-tapping screws removed in step 3.
11. Install the center tray.
12. Check that all wire harnesses are routed properly and all connectors are plugged in.
13. Connect the negative cable to the battery.
14. Install the front bulkhead cover and the intake air tube.
15. Press and hold the audio unit power button for 2 seconds to restore the audio and navi (if equipped) system functions.
16. Set the clock on vehicles without navigation.
17. If necessary, restore the system back to normal operation as described in the service information.

## Check the Operation of the Cup Holder Light

18. Set the light switch set to the  or  position, make sure the cup holder light is on.
19. Set the headlight switch to the AUTO position, and make sure the cup holder light is on with the parking lights or headlights.
20. If the cup holder light does not come on, check the fuse and all the connectors.

LIGHT SWITCH

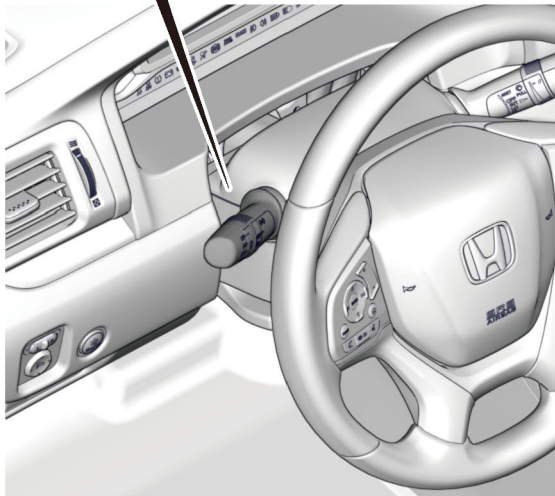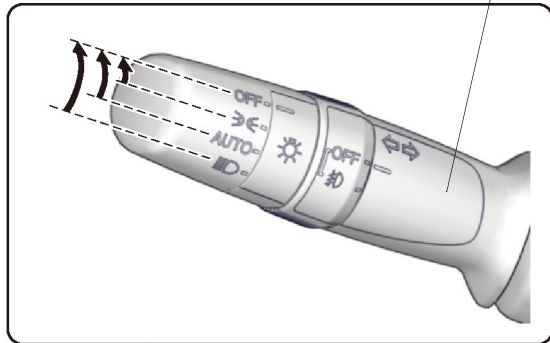

QH22312AB