



## HONDA INSTALLATION INSTRUCTIONS

Accessory  
WIRELESS CHARGER


Application  
2021 PASSPORT

Publications No.  
**VERSION 1**  
Issue Date  
SEP 2020


### PARTS LIST

**Console Panel Kit**  
P/N 08U58-TGS-100  
P/N 08U58-TGS-100A

Console panel

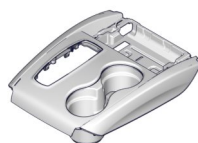


Center tray



**Wireless Charger Kit**  
P/N 08U58-TG7-100

Wireless charger unit

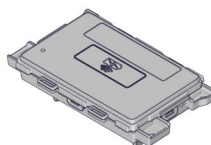

### TOOLS AND SUPPLIES REQUIRED

Phillips screwdriver  
10 mm Open end wrench  
Shop towel

*The following tools are available through the Honda Tool and Equipment Program. On the iN, click on Service > Service Bay > Tool and Equipment Program, then enter the number under "Search." Or, call 888-424-6857.*

- Trim Tool Set (T/N SOJATP2014)
- Plastic Trim Tool (T/N SILTRIMTL10)

### Illustration of the Wireless Charger in the Vehicle





CONSOLE PANEL QH50803AB

### INSTALLATION

**Customer Information:** The information in this installation instruction is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely add equipment to your vehicle. These procedures should not be attempted by "do-it-yourselfers."

1. Disconnect the negative cable from the battery:
  - Wrap a shop towel around the hood latch.

**HOOD LATCH**  
(Wrap with a shop towel.)

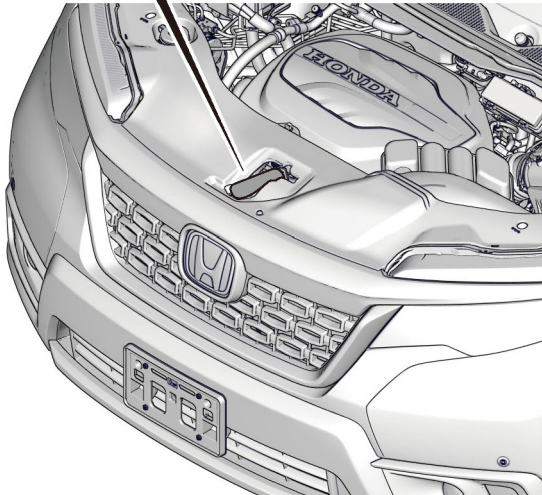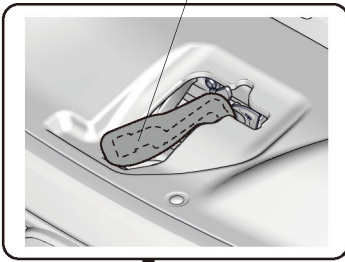


QH50702AB

- Remove the intake air tube.
- Disconnect the negative cable from the battery.

**2 CLIPS**

**INTAKE AIR TUBE**

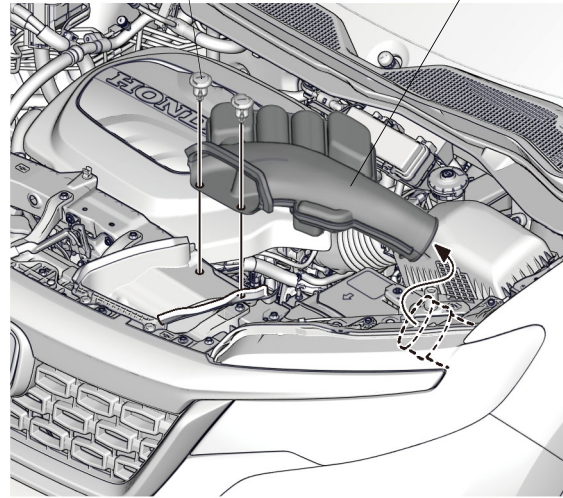


QH50704AB

- Remove the front bulkhead cover.


**FRONT BULKHEAD COVER**

**10 CLIPS**

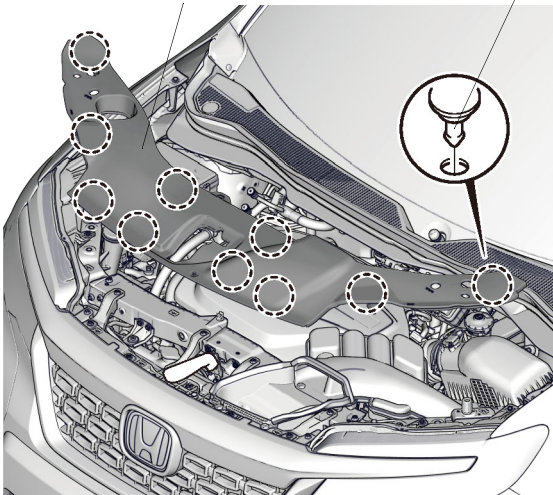



QH50703AB

2. Remove the center tray.

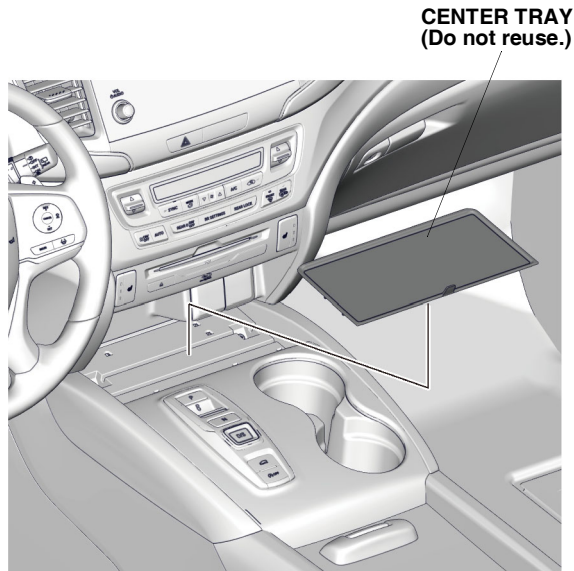


QH30602AB

3. Open the lid. Remove the console panel, and release the vehicle clip, and unplug the vehicle connectors.

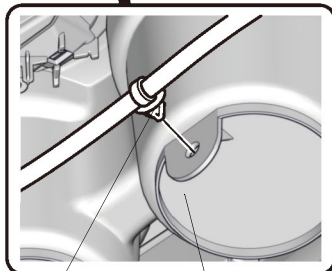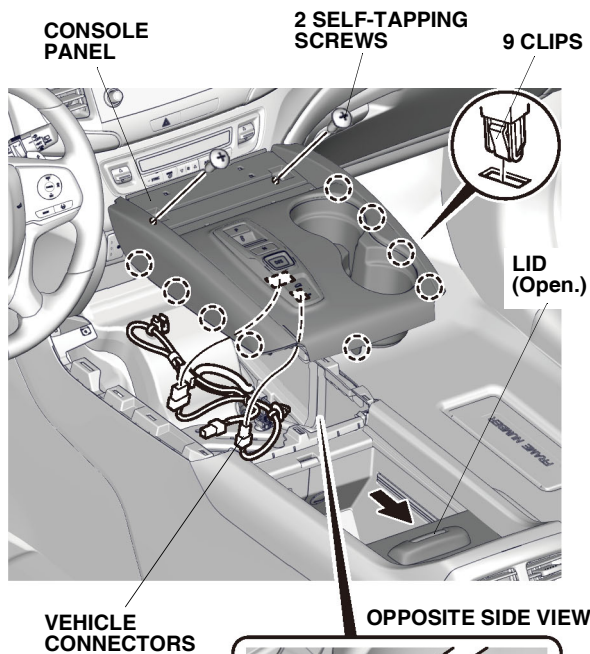


QH30603AB

4. Remove the electronic gear selector from the console panel removed in step 3.

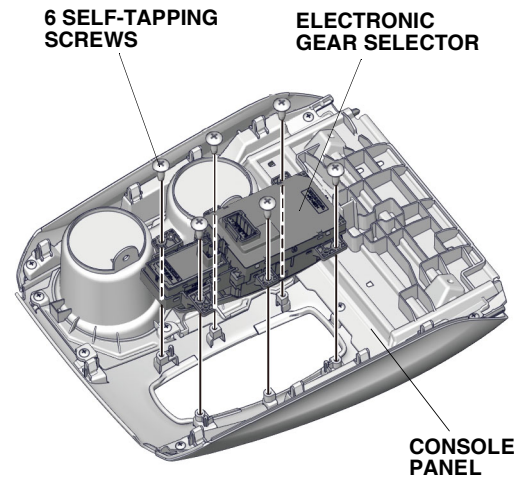

QH30605AB

5. Install the electronic gear selector to the new console panel with six self-tapping screws removed in step 4.

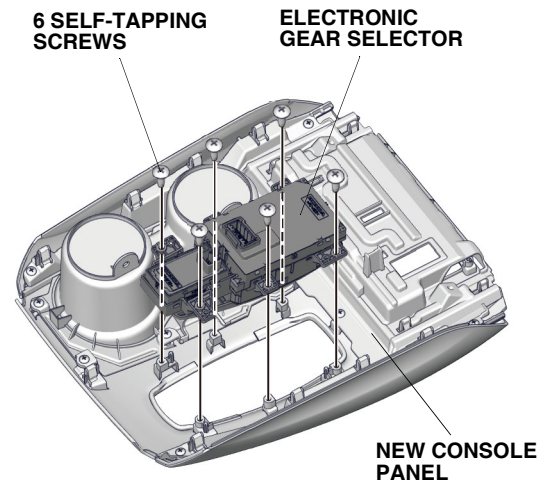


QH30606AB



If the new console side trim panels don't match the vehicle console panel, continue with step 6; otherwise, go to step 9.


## New console side trim panels don't match the vehicle console panel

6. Remove the left and right side trim from the removed console panel.

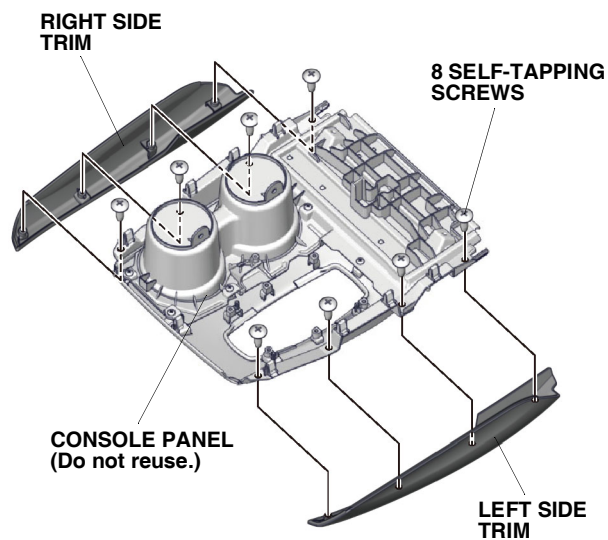


QH50705AB

7. Remove the left and right side trim from the new console panel.

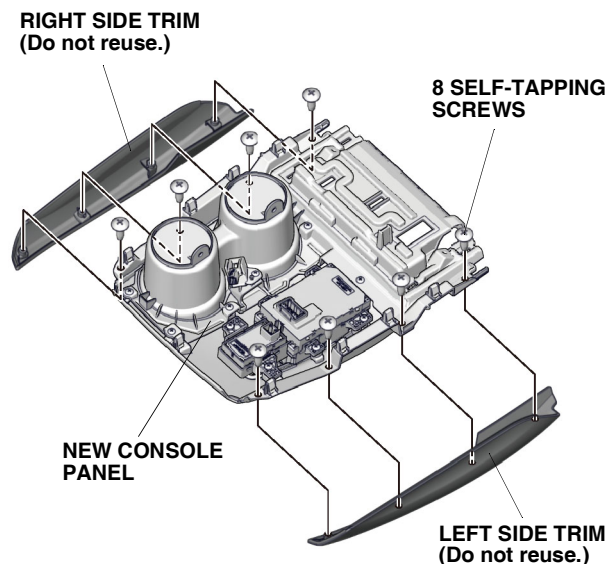

QH50804BB


8. Install the left and right side trim panels to the new console panel with eight self-tapping screws removed in step 6 or 7. Go to step 10.

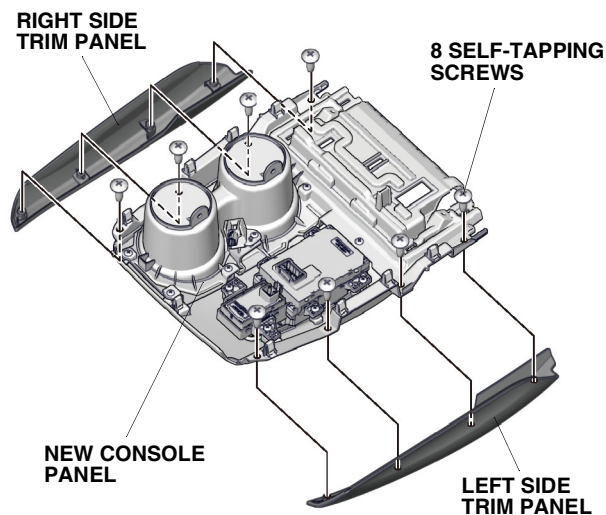

QH50804BB


## New console panel side trim color matches the vehicle console panel side trim

9. Remove the four self-tapping screws from the removed console panel.

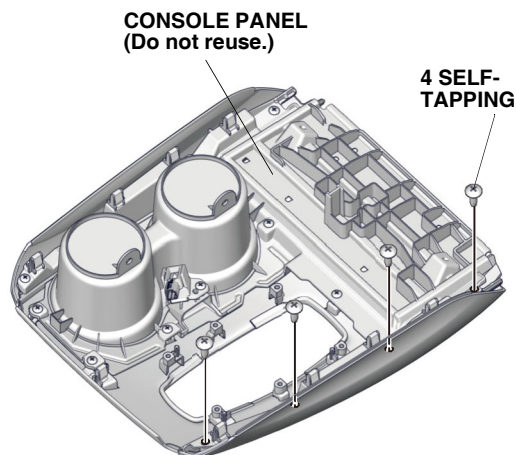


QH50805BB

10. Remove the tape to free the vehicle 2-pin connector and 7-pin connector. Route the vehicle 7-pin connector through the opening in the new console panel, and secure the vehicle harness to the new console panel with clip on the vehicle harness. Plug the vehicle 2-pin connector into the new console panel. Plug the vehicle 8-pin connector and 20-pin connector into the electronic gear selector, and secure the vehicle harness to the new console panel with the clip on the vehicle harness.

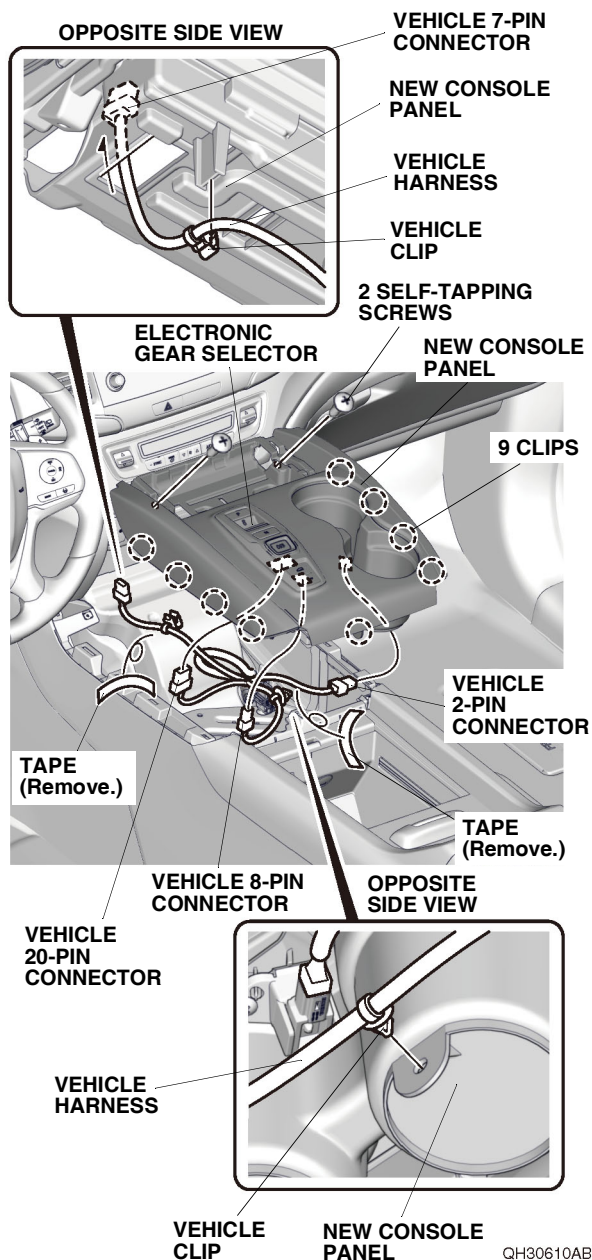


11. Install the new console panel with nine clips and two self-tapping screws removed in step 3.

12. Install the wireless charger unit to the new center tray with four retaining tabs and four self-tapping screws removed in step 6, 7, or 9.

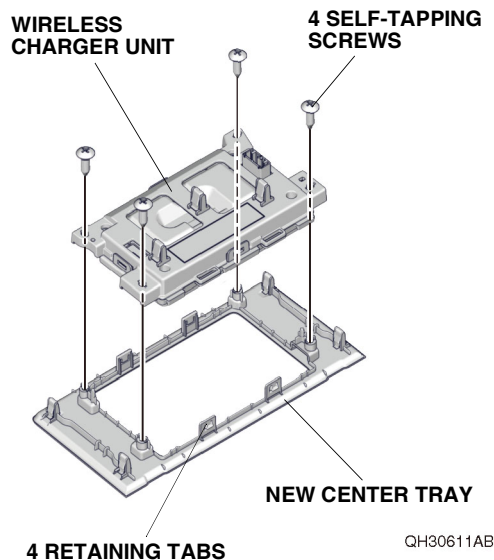

13. Plug the vehicle 7-pin connector into the wireless charger unit, and install the new center tray to the new console panel with four clips.

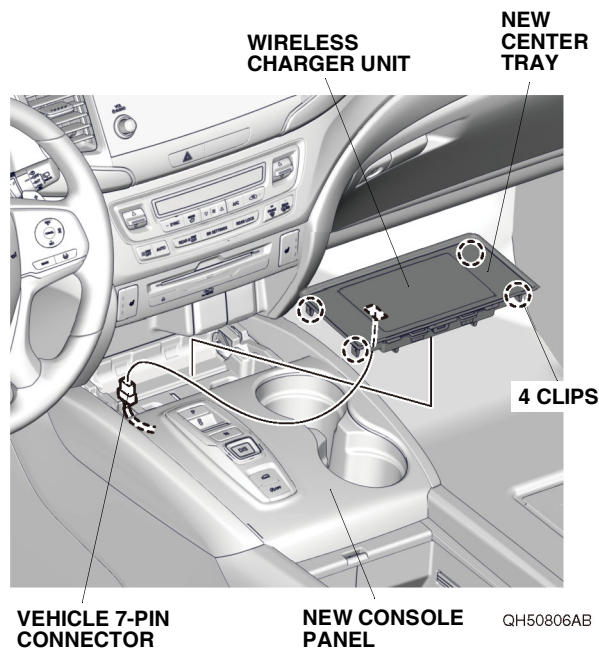

14. Check that all wire harnesses are routed properly and all connectors are plugged in.
15. Connect the negative cable to the battery.
16. Install the front bulkhead cover and the intake air tube.
17. Press and hold the audio unit power button for 2 seconds to restore the audio and navi (if equipped) system functions.
18. Set the clock on vehicles without navigation.
19. If necessary, restore the system back to normal operation as described in the service information.

## **Check the Operation of the Wireless Charger**

20. Check that the wireless charger works as described in the vehicle owner's manual.