



HONDA

INSTALLATION INSTRUCTIONS

Accessory

**FULL NOSE MASK
P/N 08P35-T6Z-100**

Application

2019 RIDGELINE

Publications No.

VERSION 1

Issue Date

FEB 2018

PARTS LIST

Mask
(hood section)



Mask
(bumper section)



6 Snap-screws



6 Washers



Elastic cord



TOOLS AND SUPPLIES REQUIRED


Stubby Phillips screwdriver

Flat-tip screwdriver

Utility knife

Illustration of the Full Nose Mask on the Vehicle

**MASK
(HOOD SECTION)**

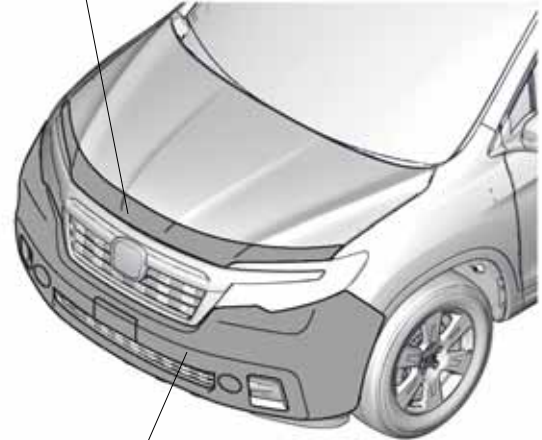

**MASK
(BUMPER SECTION)**

QF11501AC

INSTALLATION

Customer Information: The information in this installation instruction is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely add equipment to your vehicle. These procedures should not be attempted by "do-it-yourselfers."


NOTE:

- Make sure the vehicle and nose mask are clean and completely dry before installation. If moisture under the mask is allowed to dry, it may cloud the paint. If the mask gets wet, remove and allow it to air-dry completely.
- Make sure any repainted surfaces are cured.
- Wax the hood and nose of the vehicle with a high-quality paste wax.
- Install the nose mask securely. If the nose mask starts to flap or comes loose while driving, safely pull off the road, stop the vehicle, and secure or remove the nose mask.

Displaying the License Plate

If your state law requires the display of both license plates, cut out the piece that covers the front license plate:


- Face the inside of the mask toward you.
- Carefully cut out the license plate area with a utility knife at the top seam and remove the overcast stitching.

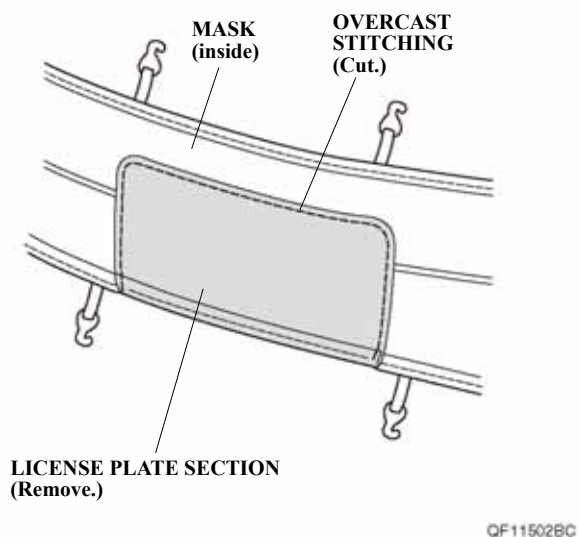

With Fog Lights

If the vehicle is equipped with fog lights, cut out the piece that covers them:


- Face the inside of the mask toward you.
- Carefully cut out the fog light area with a utility knife at the top seam and remove the overcast stitching. Repeat for the other side.

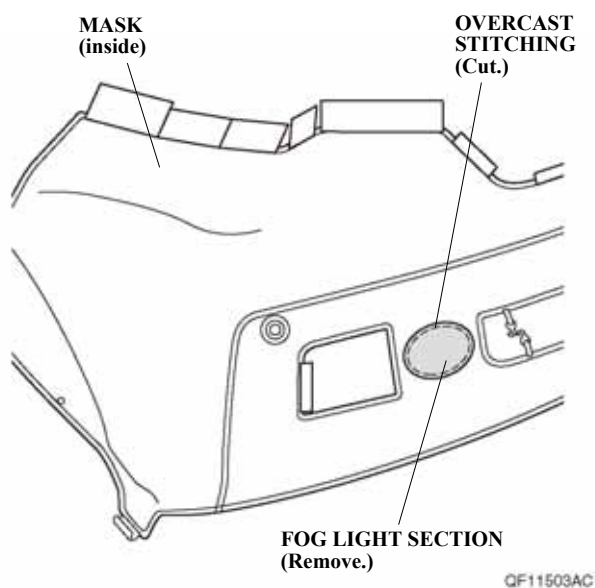

With Front Corner Sensors

If the vehicle is equipped with front corner sensors, cut out the section that covers them:


- Face the outside of the mask toward you.
- Carefully cut out the left front corner sensor area with a utility knife along the concave line. Repeat for the other side.

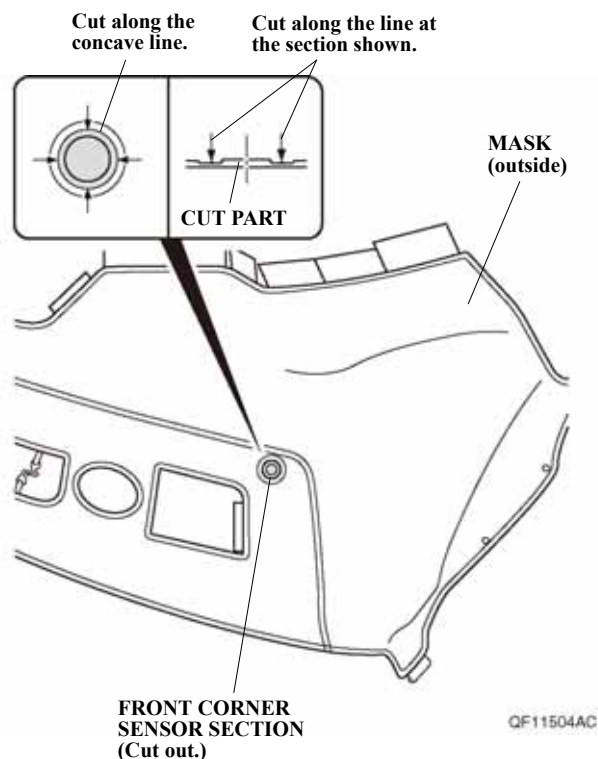

Installing the Hood Section

1. Open the hood. Fit the corners of the hood section around the hood and adjust it so it fits smoothly over the edges. Attach the three hooks to the hood.

NOTE: Do not fold back the rubber seal inside the hood when installing the hook. Pulling the hooks with excessive force can break the hook strap.

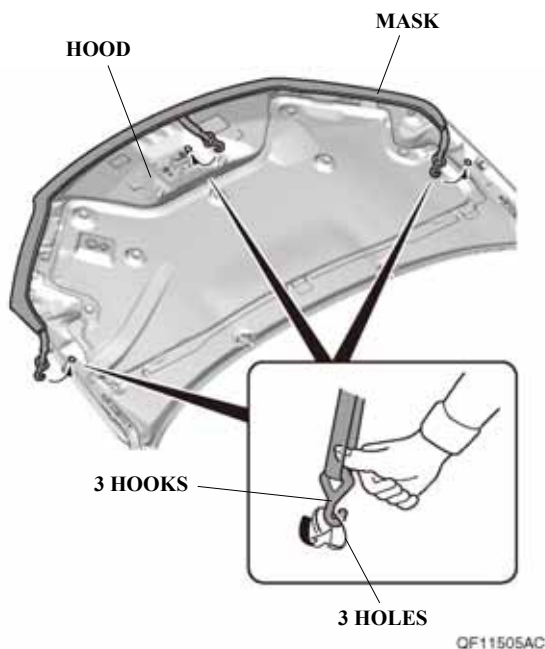

Installing the Bumper Section


2. Remove the three self-tapping screws from the left front fender and front bumper.




3. Install the three snap-screws and three washers on the front bumper.



4. Repeat steps 2 and 3 on the right side of the vehicle.
5. Pull the mask back toward the fenderwell, smooth out any wrinkles then secure the three snaps on the mask to the three snap-screws.

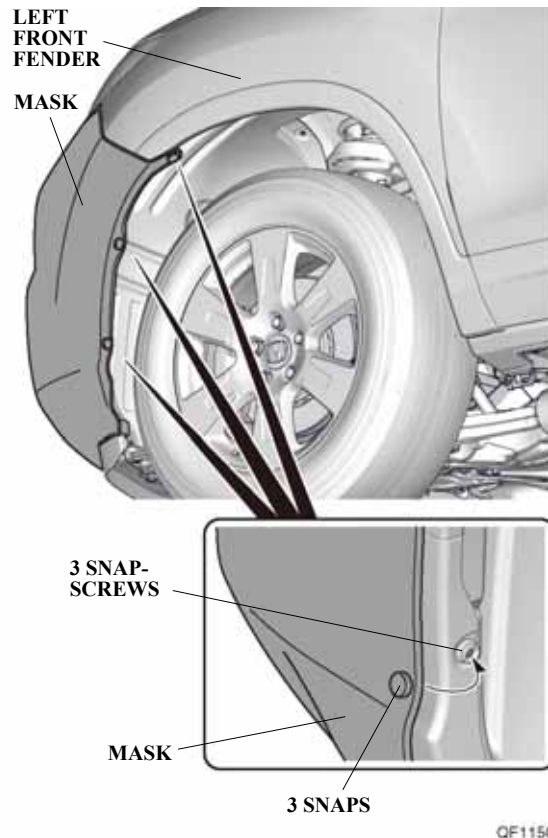


6. Attach one hook to the fenderwell.

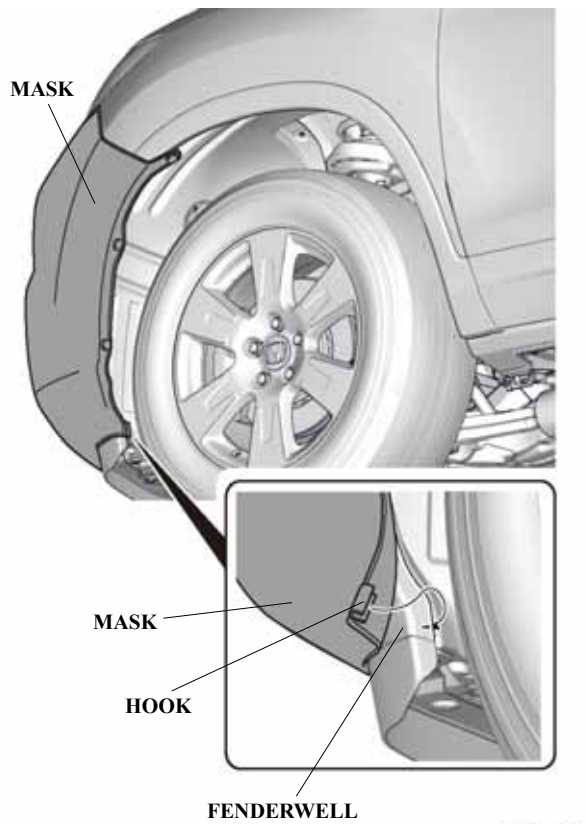


7. Repeat steps 5 and 6 on the right side of the vehicle.

8. Insert the five tabs under the left headlight.

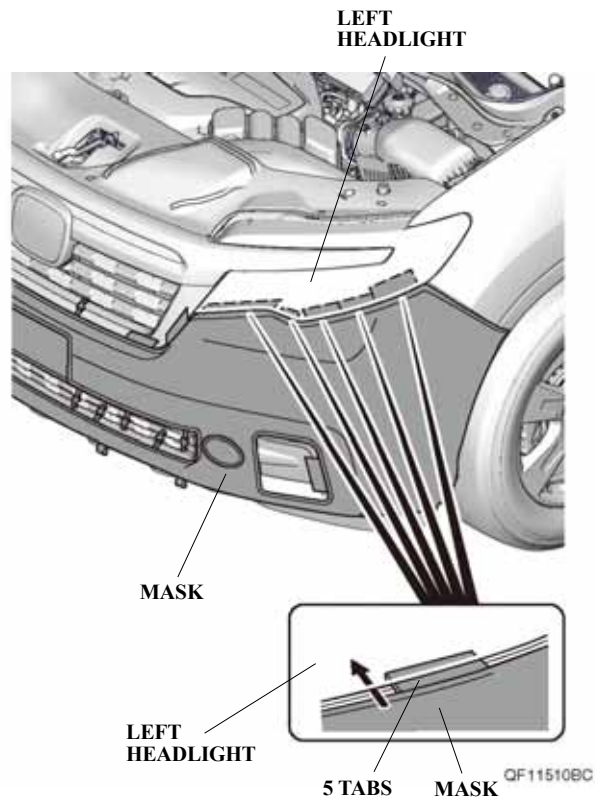


9. Insert one tab into the left turn signal light.

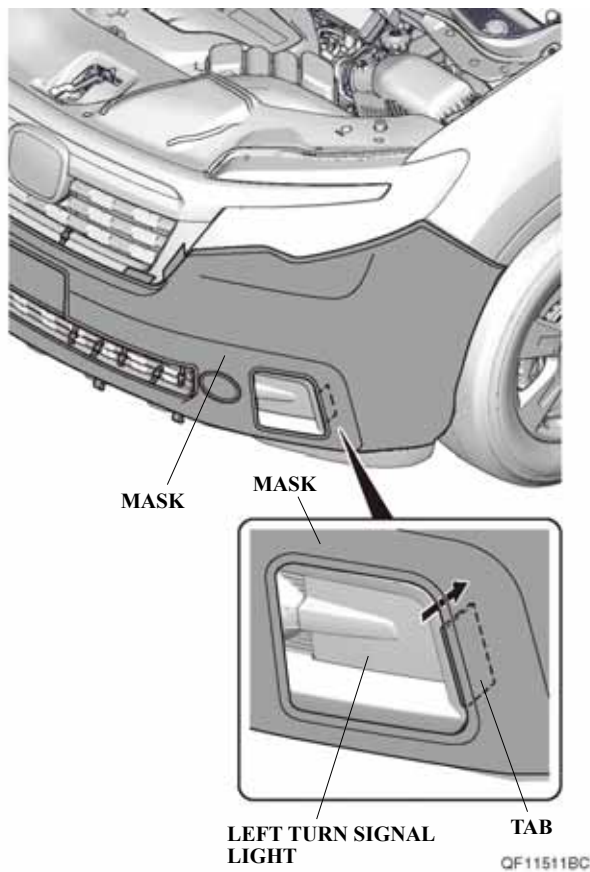


10. Repeat steps 8 and 9 on the right side of the vehicle.


11. Insert the four tabs under the front upper grille. Attach the two hooks to the inside edge of the front upper grille.
NOTE: Pulling the hooks with excessive force can break the hook strap.

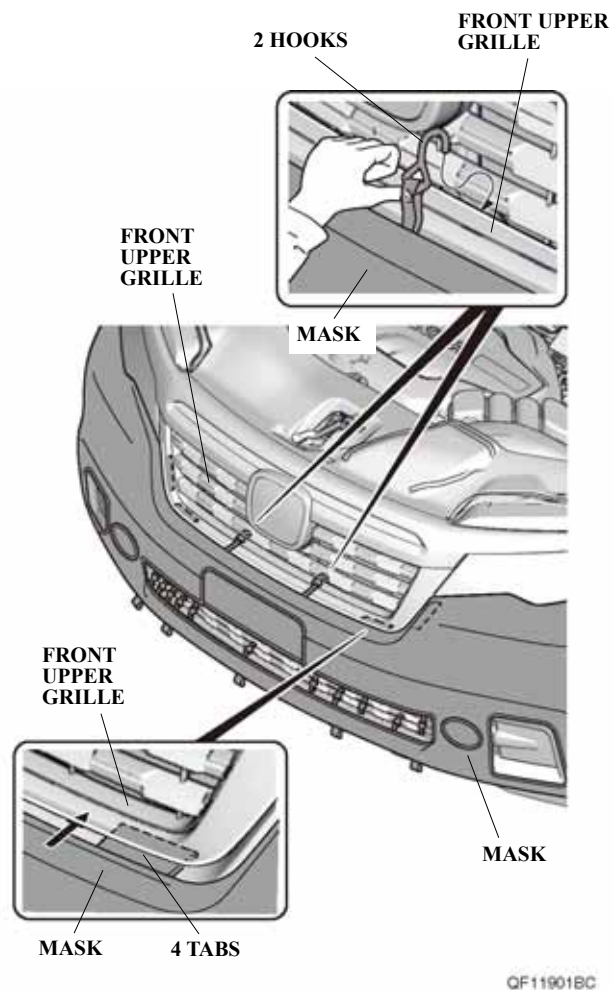

12. Attach the 11 hooks to the inside edge of the front lower grille.
NOTE: Pulling the hooks with excessive force can break the hook strap.

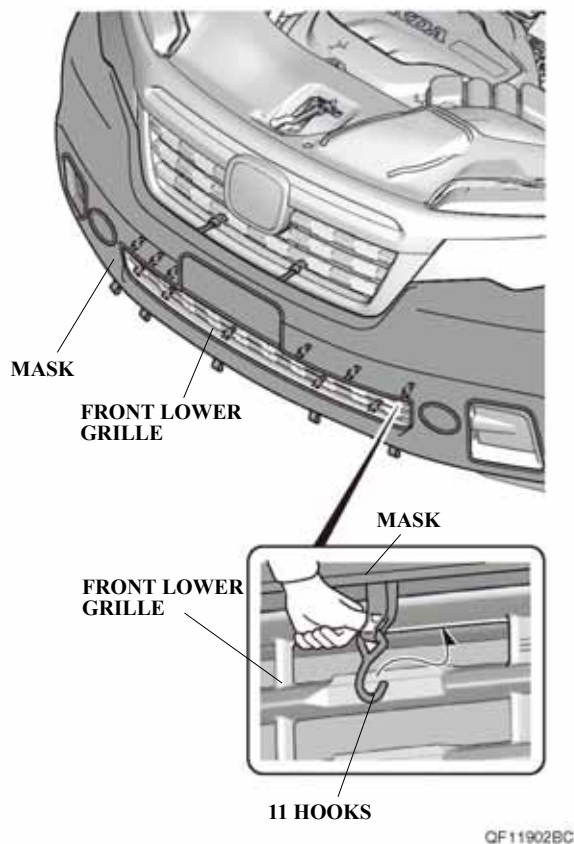

13. Route the elastic cord through the five loops on the bottom of the mask. Then, attach one hook to the hole in the front inner fender and attach the other hook to the hole in the front inner fender on the other side.

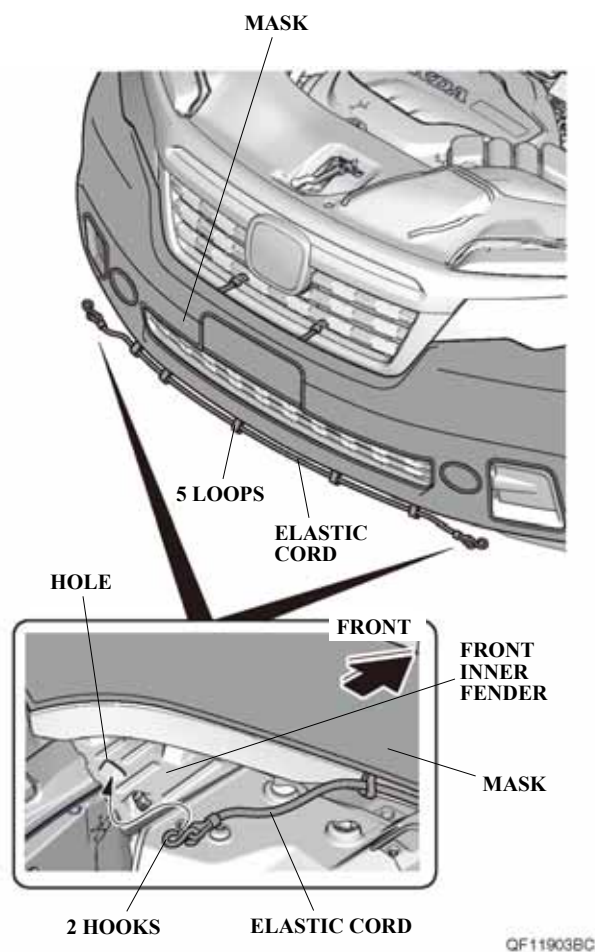

CLEANING THE NOSE MASK

Use a sponge or cloth and a solution of mild liquid dishwashing soap and water to clean the vinyl and the flannel backing. Rinse the mask completely with clean water, and hang it to dry out of direct sunlight. Make sure the mask is completely dry before you reinstall it.