



INSTALLATION INSTRUCTIONS

Accessory
CD PLAYER

Application
2018 PILOT

Publications No.
VERSION 1
Issue Date
NOV 2017

PARTS LIST

Attachment Kit
P/N 08A06-TG7-100

Left bracket



Right bracket



4 Flange bolts, 5 x 7 mm



2 Bolts, 6 mm



Accessory socket holder
(May not used)



Accessory socket and USB socket holder
(May not used)



CD Player Kit
P/N 08A06-TG7-100A

CD Player unit



TOOLS AND SUPPLIES REQUIRED

Phillips screwdriver

Ratchet

8 mm Socket

10 mm Open end wrench

EXTERNAL TORX wrench

Shop towel

The following tool is available through the Honda Tool and Equipment Program. On the iN, click on Service > Service Bay > Tool and Equipment Program, then enter the number under "Search." Or, call 888-424-6857.

- Trim Tool Set (T/N SOJATP2014)
- Plastic Trim Tool (T/N SILTRIMTL10)

Illustration of the CD Player Unit on the Vehicle



CD PLAYER UNIT



QDN2701AG

INSTALLATION

Customer Information: The information in this installation instruction is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely add equipment to your vehicle. These procedures should not be attempted by “do-it-yourselfers.”


1. Wrap a shop towel around the hood latch.

HOOD LATCH
(Wrap with a shop towel.)

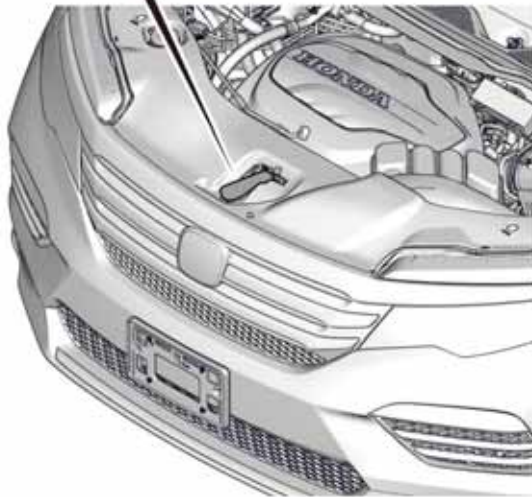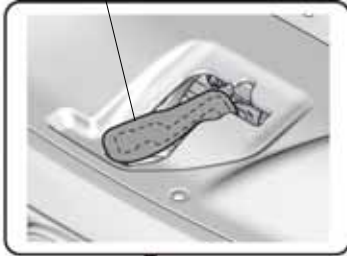


QDN1301AA

- Remove the front bulkhead cover.

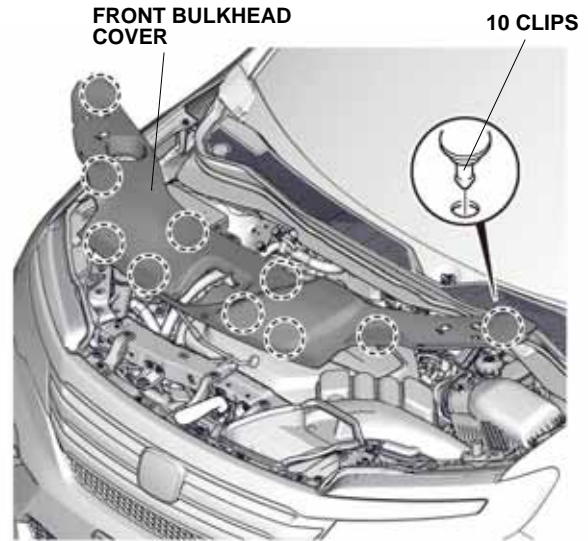


QDN1302AA

- Remove the intake air tube.
- Disconnect the negative cable from the battery, then wait at least 3 minutes before starting work.

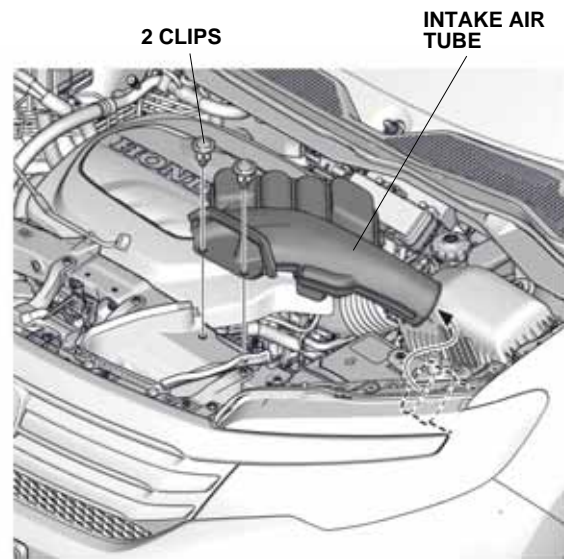


QDN1303AA


2. Pull away the door opening seal, and remove the passenger's dashboard side lid.

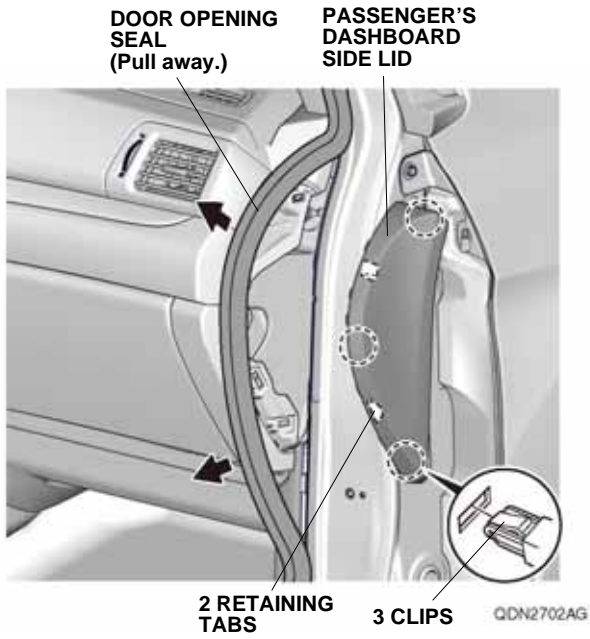


3. Open the glove box.

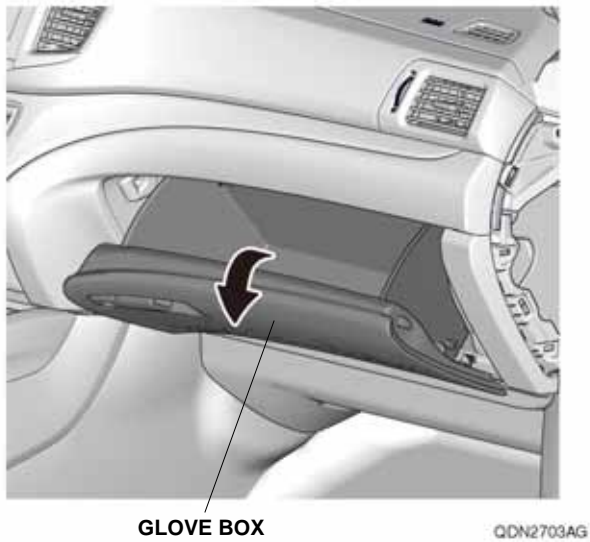


4. Remove the passenger's lower panel.

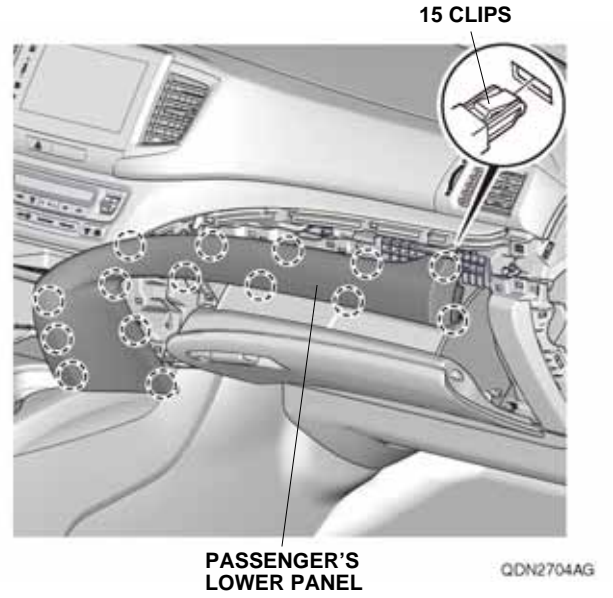


5. Pull away the door opening seal, and remove the driver's dashboard side lid.

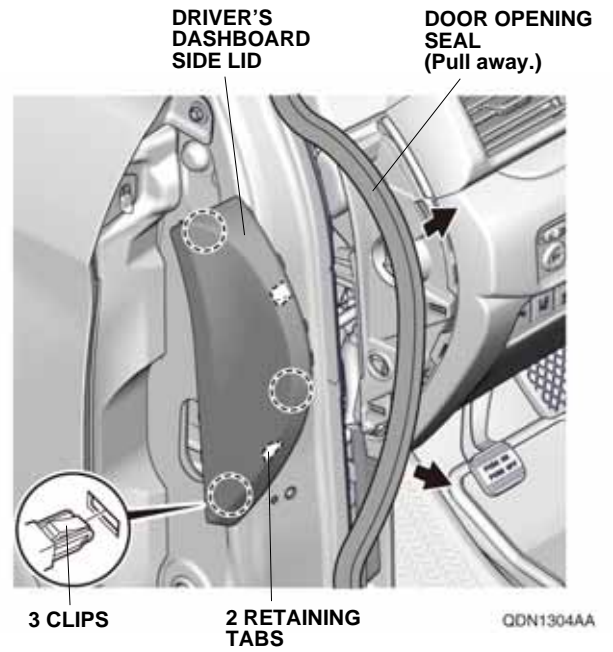


6. Remove the driver's dashboard lower cover and release the vehicle sensor.

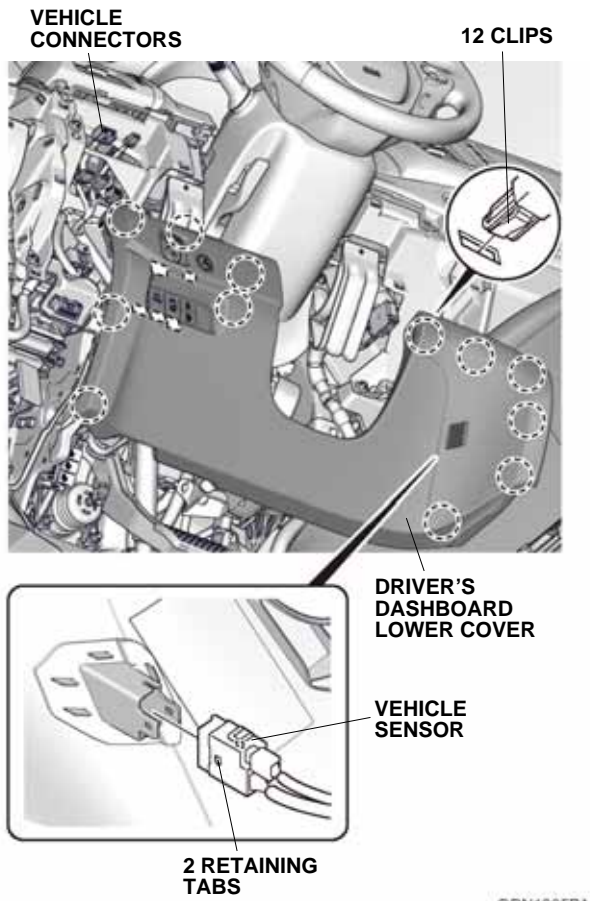


7. Remove the center upper panel and unplug the vehicle connector.

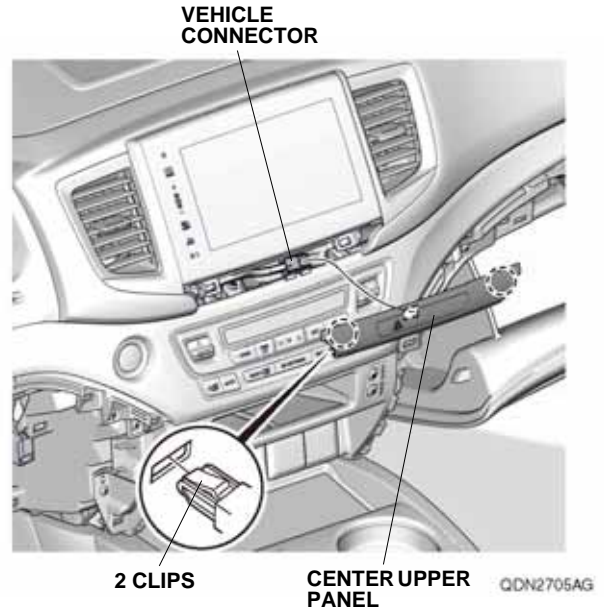


8. Remove the center lower panel and unplug the vehicle connectors.

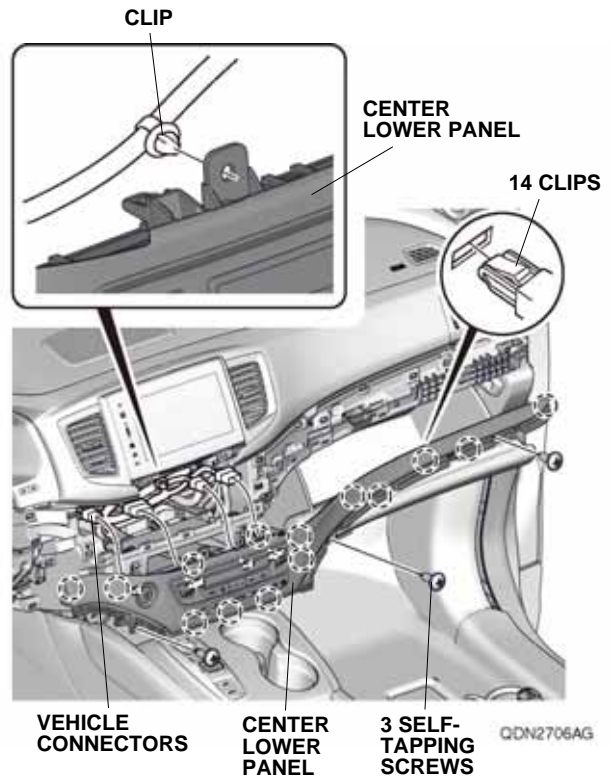


9. Remove the center tray.

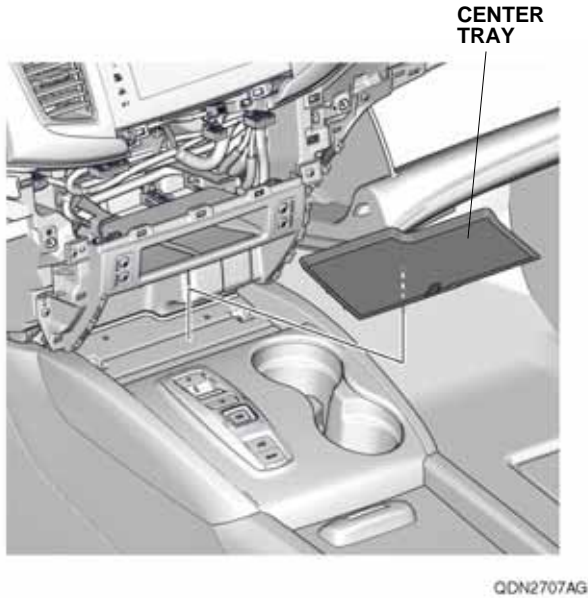


11. Remove the seat heater switches or lids from the lower panel.

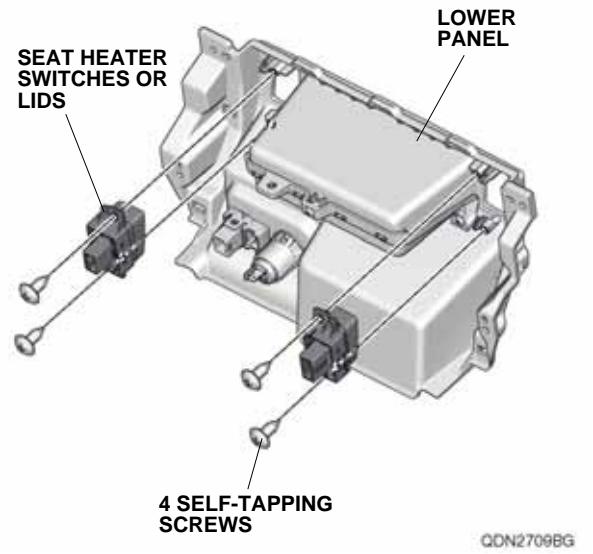


10. Remove the lower panel and unplug the vehicle connectors.

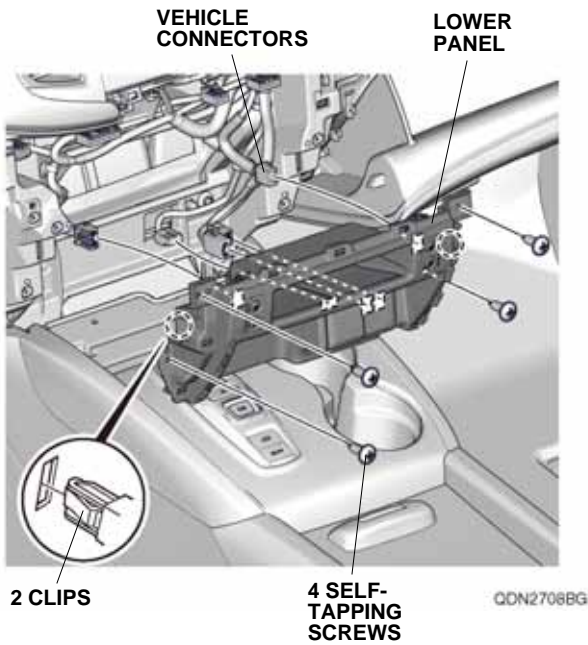

12. Remove the accessory socket from the accessory socket and USB socket holder or accessory socket holder.

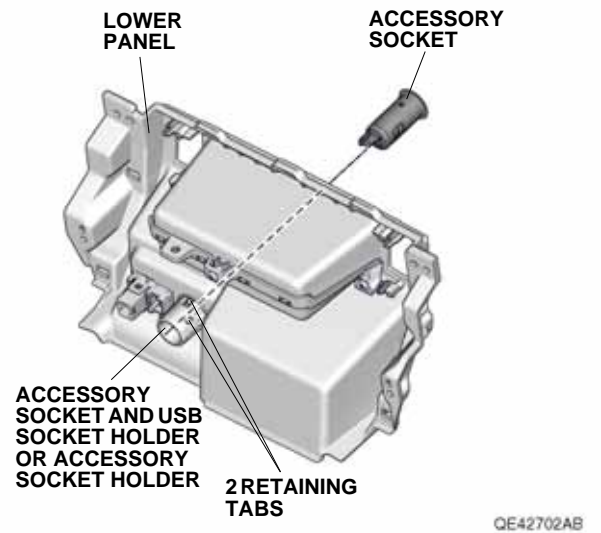

13. Remove the accessory socket and USB socket holder or accessory socket holder from the lower panel. If vehicle is equipped with the accessory socket holder, discard it.

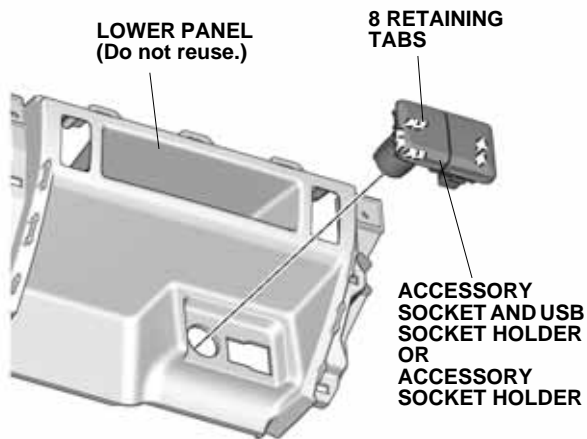


QDN2710BG

If the vehicle is equipped with a USB connector, continue with step 14; otherwise, go to step 16.


With the USB connector

14. Remove the USB adapter from the accessory socket and USB socket holder removed in step 13.

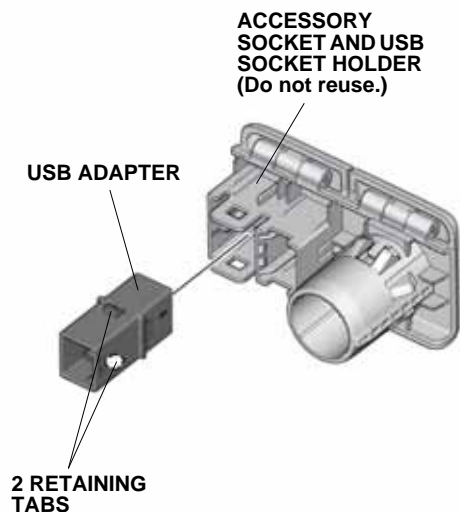


QE42703AB

15. Install the USB adapter removed in step 14 onto the new accessory socket and USB socket holder.

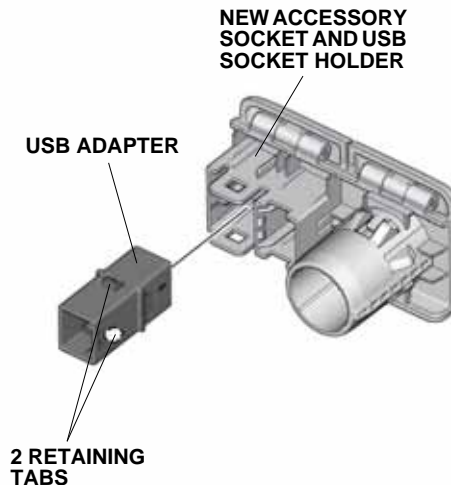


QE42703AB

16. Install the seat heater switches or lids to the CD player unit with four self-tapping screws removed in step 11.

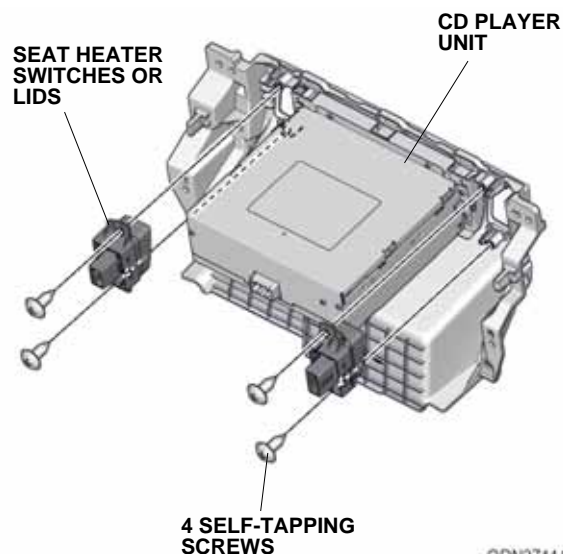


QDN2711AG

17. Install the new accessory socket and USB socket holder or new accessory socket holder on the CD player unit.

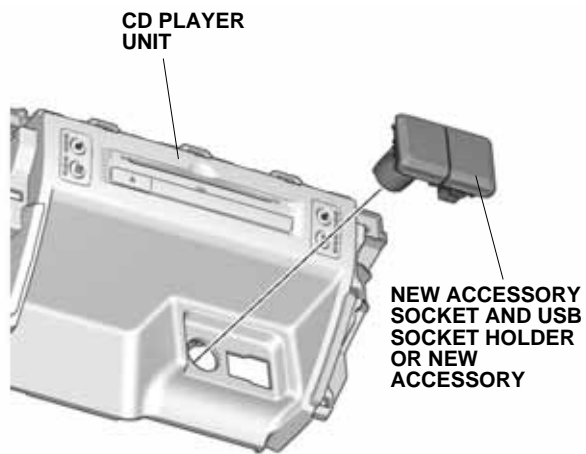


QDN2712BG

18. Install the accessory socket removed in step 12 to the new accessory socket and USB socket holder or new accessory socket holder.

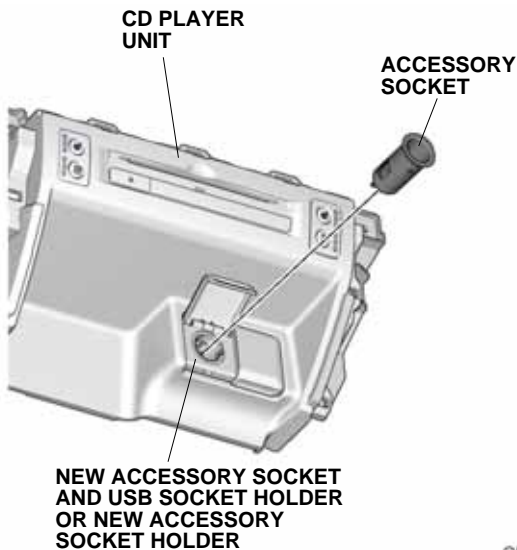


QE42704AB

19. Install the left and right brackets on the CD player unit with four 5 x 7 mm flange bolts.

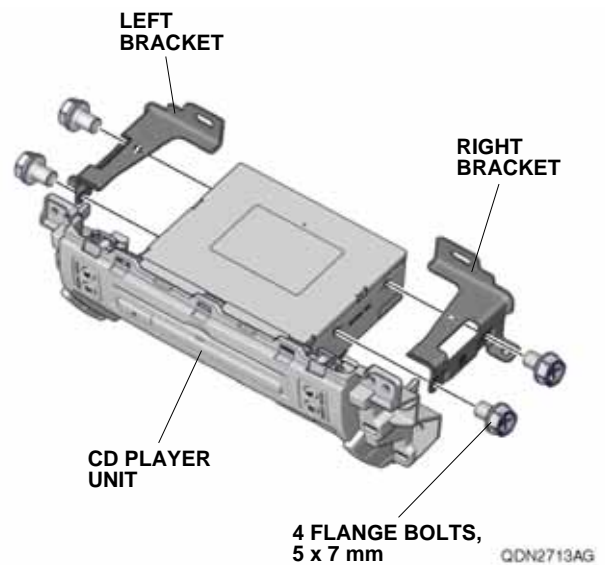

20. Remove the tape from the vehicle harness.

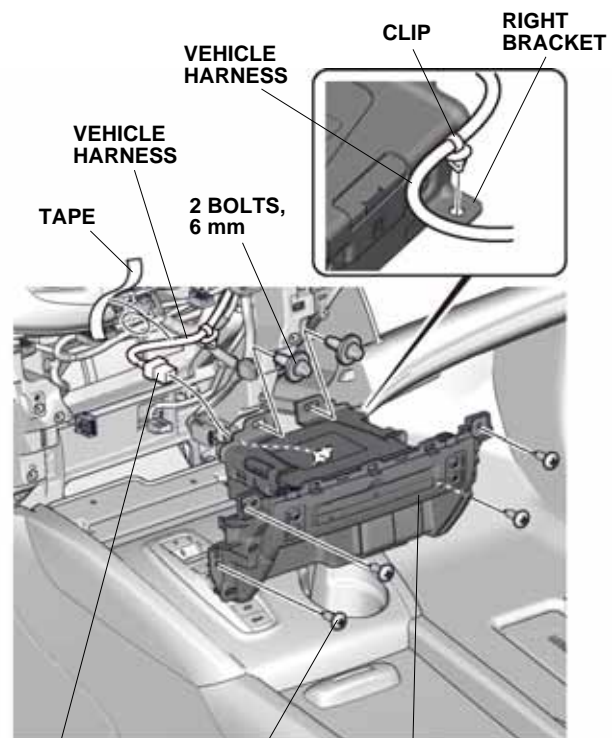

VEHICLE CONNECTOR 4 SELF-TAPPING SCREWS CD PLAYER UNIT QDN2714AG

21. Plug the vehicle connector, and secure the vehicle harness to the right bracket with clip on the vehicle harness.
22. Install the CD player unit to the dashboard with two 6 mm bolts and four self-tapping screws removed in step 10.

23. Check that all wire harnesses are routed properly and all connectors are plugged in.
24. Install all removed parts except for the front bulkhead cover and the intake air tube.
25. Connect the negative cable to the battery.
26. Install the front bulkhead cover and the intake air tube.
27. Press and hold the audio unit power button for two seconds to restore the audio and navi (if equipped) system functions.
28. Set the clock on vehicles without navigation.
29. If necessary, restore the systems back to normal operation as described in the service information.

Check the Operation of the CD player unit

30. Check the operation of the CD player unit according to the vehicle Owner's Manual.